

JTB00539NAS1

TECHNICAL BULLETIN

08 DEC 2012



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

SECTION:

501-12

SUBJECT/CONCERN:

'Rattle' Noise From Front Overhead Console

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
XJ Range (X351)	2017	V92474-W05397	Castle Bromwich

MARKETS:

NAS

CONDITION SUMMARY:**SITUATION:**

A rattle noise from the front overhead console may be evident.

CAUSE:

This may be caused by a front overhead console tolerance issue.

ACTION:

Should a Customer express this concern, follow the Service Instruction below.

PARTS:**NOTE:**

An allowance (\$1.55 USD) has been allocated for the felt sheet, to be sourced from the Squeaks & Rattles kit, and must be claimed using ZZZ001.

PART NUMBER	DESCRIPTION	QUANTITY:
ZZZ001	0.5 mm felt sheet	\$1.55 USD

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

NOTE:

*Add the trim color code of part used when submitting the causal part number.

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.
- DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Front overhead console - Modify	76.13.95	0.3	33	C2D50956XXX*


NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:

- 1 Remove the front overhead console (see TOPIx Workshop Manual section 501-12: Instrument Panel and Console - Overhead Console).

2 

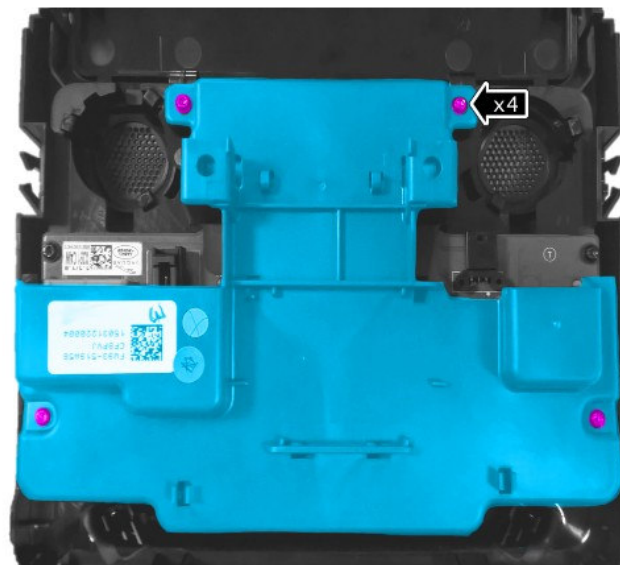

E201543

Remove the trim cover.

3




E201544

Remove the circuit board.

4

NOTES:

- The front overhead console may have four or six buttons; four-button version shown.
- White buttons require modification; gray buttons do not require modification.

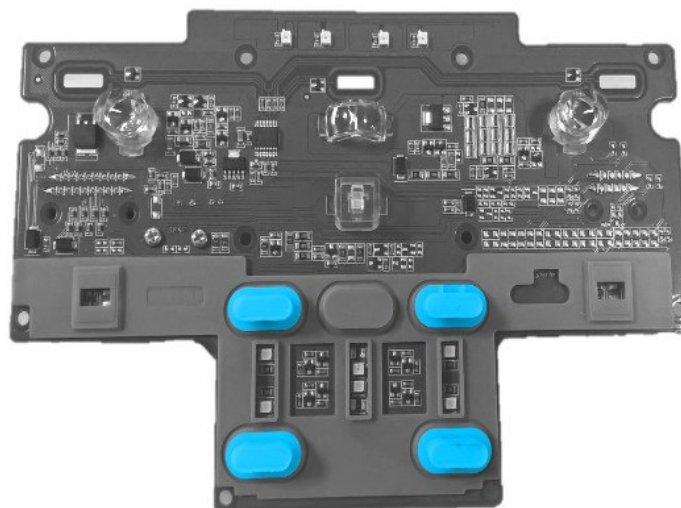


E201555

Visually inspect the color of the four or six front overhead console buttons.

- If all the buttons are gray, this is not the cause of the Customer's concern.
 - Go to step 9.
- If any of the buttons are white, go to Step 5.

5 

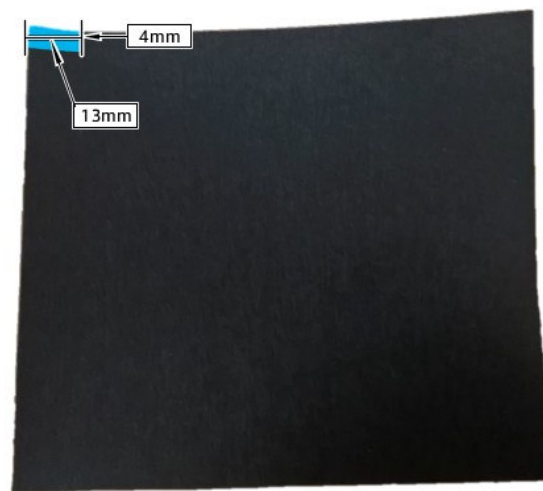


E201557

Cut a patch (13 mm X 4 mm) from the 0.5 mm felt sheet in the Jaguar Squeaks & Rattles kit.

6 Remove the backing from the patch.

7

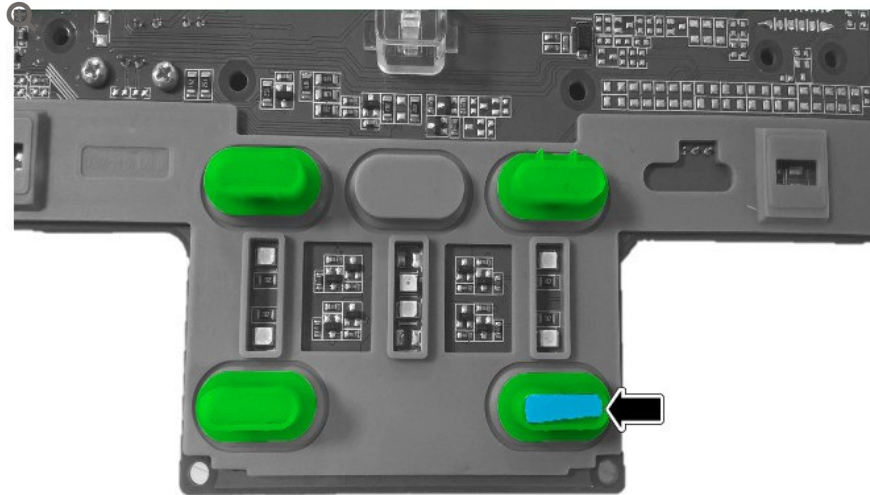

E201556

Install the 0.5 mm felt patch into this button as shown.

- 8 Repeat Steps 5-7 as required to all the remaining white buttons.

9 




E201544

Install the circuit board.

- Torque: **0.6 +/- 0.1 Nm**

10

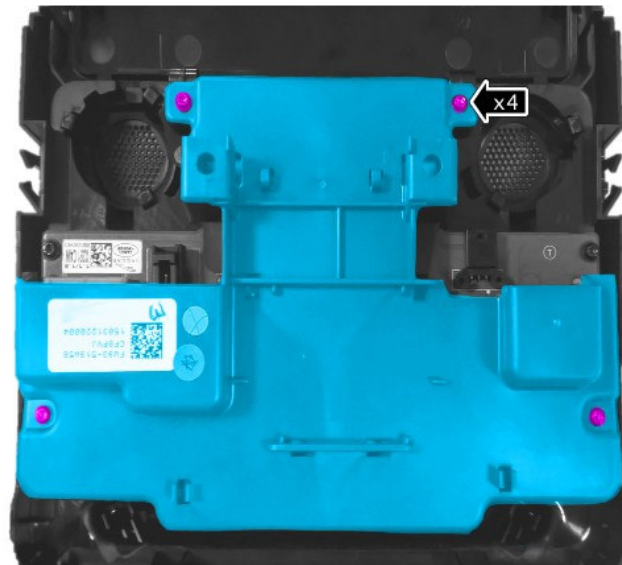

E201543

Install the trim cover.

- Torque: **0.6 +/- 0.1 Nm**

- 11 Install the front overhead console (see TOPIx Workshop Manual section 501-12: Instrument Panel and Console - Overhead Console).