

Service

Category Vehicle Interior

Section Theft Deterrent/Keyless Entry Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2013 - 2015	CT200H	
2014 - 2015	GX460	
2010 - 2015	RX350, RX450H	

Introduction

Some 2010 – 2015 model year Lexus vehicles with the RES+ accessory may exhibit a condition of not being able to remote start the vehicle through their smart phone application in some areas. The user will receive a mobile device message "Waiting the answer from VIN", indicating the network was unable to connect to their vehicle. The cause of this may be related to the provider's 3G and 4G wireless infrastructure upgrades, resulting in the elimination of 2G network capabilities. Follow the procedures in this bulletin to address this condition.

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
EL1618	R & R Remote Engine Starter (RES+) ECU and Initialize	0.5	PT398-60135-AA PT398-48132-AA	99	74

APPLICABLE WARRANTY

- This repair is covered under the Lexus Basic Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.



Parts Information

PART NU	JMBER	DADTNAME		
PREVIOUS	NEW	PART NAME		
PT398-60135-AA	DT200 00454 AA	DEC. FOLI	4	
PT398-48132-AA	PT398-00151-AA	RES+ ECU	ı	

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
Techstream 2.0*	ADE	TS2UNIT	1

NOTE

- Do NOT use Techstream Lite.
- Software version 11.20.019 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

^{*} Essential SST.

Repair Procedure

1. Confirm vehicle is equipped with RES+.


NOTE

- Look for RES+ window stickers on the driver or passenger front window glass.
- . Look for RES+ key tag on the Smart Key ring.

Is the vehicle equipped with RES+?

- YES Continue to step 2.
- **NO** This bulletin does NOT apply. Continue diagnosis using the applicable Accessory Diagnostic Guide on page 4.

Figure 1.

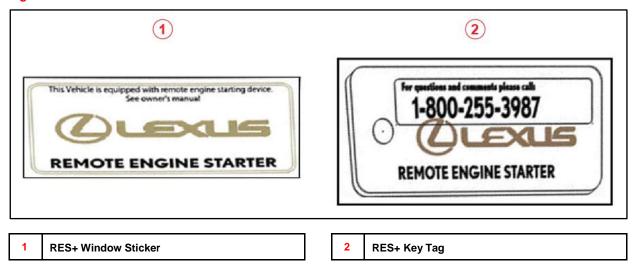

2. Verify RES+ ECU is 2G or 3G.

Figure 2. 3G ECU Antenna Connectors are on ONE Side of the ECU


 


Figure 3. 2G ECU Antenna Connectors are on BOTH Sides of the ECU

 

Is the vehicle equipped with a 3G ECU?

- **YES** STOP. This bulletin does NOT apply. Continue diagnosis using the applicable Accessory Diagnostic Guide on page 4.
- NO Continue to Step 3.

L-SB-0084-16 September 30, 2016 Page 4 of 5

Remote Engine Starter (RES+) ECU Update from 2G to 3G

Repair Procedure (Continued)

Refer to the Technical Information System (TIS), applicable model and model year Accessory Diagnostic Guide:

NOTE

- The procedures listed below should be followed until the RES+ ECU Preparation and Installation Procedure.
- It is NOT necessary to remove the A-Pillar.
- 2013 2015 CT 200h:

Accessory – Accessory Diagnostic Guide – "2011 – 2015 CT200h TVIP V9 Remote Engine Starter Plus (Res+) PT398-76151 Rev. B"

• <u>2014 – 2015</u> GX 460:

Accessory – Accessory Diagnostic Guide – "2014 – 2015 GX460 TVIP V9 Remote Engine Starter Plus (Res+) PT398-60151 Rev. B"

2010 – 2015 RX 350:

Accessory – Accessory Diagnostic Guide – "2010 – 2015 RX350 TVIP V9 Remote Engine Starter (RES+) PT398-48151 Rev. B"

• 2010 – 2015 RX 450h:

Accessory – Accessory Diagnostic Guide – "2010 – 2015 RX450h TVIP V9 Remote Engine Starter (RES+) PT398-48151 Rev. B"

3. Replace with NEW 3G ECU and initialize.

Refer to TIS applicable model and model year Accessory Installation Guide:

NOTE

The procedures listed below should be followed from the Registration Preparation section EXCLUDING the tags and labels step.

• 2013 – 2015 CT 200h:

Accessory – Accessory Installation Guide – "2011 – 2015 CT200h TVIP V9 Remote Engine Starter Plus (Res+) PT398-76151 Rev. B"

• <u>2014 – 2015</u> GX 460:

Accessory – Accessory Installation Guide – "2014 – 2015 GX460 TVIP V9 Remote Engine Starter Plus (Res+) PT398-60151 Rev. B"

• 2010 – 2015 RX 350:

Accessory – Accessory Installation Guide – "2010 – 2015 RX350 TVIP V9 Remote Engine Starter (RES+) PT398-48151 Rev. B"

Repair Procedure (Continued)

- 2010 2015 RX 450h:
 Accessory Accessory Installation Guide "2010 2015 RX450h TVIP V9 Remote Engine Starter (RES+) PT398-48151 Rev. B"
- 4. Confirm remote start operation with the smart phone application.