

Service

Category Audio/Visual/Telematics

Section	Navigation/Multi Info Display	Market USA	Toyota Supports
Section	Navigation/Multi Info Display	Market USA	Toyota Supports

#### Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2016	4Runner, Avalon, Avalon HV, Highlander, Highlander HV, Prius, Prius V, Sequoia, Sienna, Tacoma, Tundra	

#### Introduction

Some 2016 model year applicable vehicles equipped with Entune<sup>™</sup> Audio (version 01013E) / Entune<sup>™</sup> Audio Plus (version 010156 or 01015C) / Entune<sup>™</sup> Premium Audio (version 010171 or 010170 or 01017D) may exhibit one or more of the following conditions:

- Head unit rebooting at a specific location.
- Abnormal destination search operation.
- Rebooting caused by no songs on the USB connected iPhone.
- One time reboot after ACC-ON.
- Audio stays muted after the key is cycled.

Updated system software is now available to address these conditions. Follow the Software Update Procedure in this bulletin to install the latest software version.

## Warranty Information

OP CODE	DESCRIPTION	MODEL	TIME	OFP	T1	T2
EL1608	Software Update	4Runner	0.3	86100-35351 86100-35361 86100-35371 86100-35381 86100-35391 86100-35401 86100-35401 86100-35421 86100-35431 86100-35430 86100-35470 86100-3540 86100-35450 86100-35490 86100-35500 86100-35500	87	74
		Avalon, Avalon HV		86140-07100 86804-07110 86804-07120 86100-07131 86100-07141		
		Highlander, Highlander HV		86804-0E270 86100-0E271 86804-0E280 86100-0E281		
		Prius		86140-47270 86804-47340 86804-47330 86100-47561 86100-47461		

## Warranty Information (Continued)

OP CODE	DESCRIPTION	MODEL	TIME	OFP	T1	T2
EL1608	Software Update	Sequoia		86140-0C150 86140-0C160 86804-0C160 86804-0C170 86804-0C180 86804-0C190 86100-0C220 86100-0C230 86100-0C240 86100-0C250		
		Sienna	0.3	86804-08030 86804-08040 86100-08061 86100-08071		
		Tacoma		86804-04090 86140-04100 86804-04120 86804-04130 86100-04160 86100-04170 86100-04180 86140-04160 86140-04170 86140-04180	87	74
		Tundra		86100-0C181 86100-0C191 86100-0C201 86100-0C211 86804-0C120 86804-0C130 86804-0C130 86804-0C150 86140-0C100 86140-0C110 86140-0C130 86140-0C130		

### Warranty Information (Continued)

OP CODE	DESCRIPTION	MODEL	TIME	OFP	T1	T2
EL1608	Software Update	Prius V	0.3	86100-47601 86100-47611 86100-47621 86100-47631 86804-47290 86804-47300 86804-47310 86804-47320 86140-47450	87	74

#### APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

#### Firmware Update Information

MODEL		FIRMWARE UPDATE FILE
MODEL		NEW
Avelon Avelon HV	Entune™ Audio Plus	13TDDANA-DA11_0094.kwi
	Entune™ Premium Audio	13TDANNA-DA12_0130.kwi
Tacoma, Tundra, Prius, Prius V	Entune™ Audio	13TBDANA-DA10_0068.kwi
Tacoma, Tundra, Sequoia	Entune™ Audio Plus	13TDDANA-DA10_0094.kwi
Tundra (South America)	Entune™ Audio Plus	13TDDANA-DA12_0094.kwi
Tacoma, Tundra, Prius, Prius V, Sequoia, Highlander, Highlander HV, 4Runner, Sienna	Entune™ Premium Audio	<u>13TDANNA-DA11_0130.kwi</u>

### Software Update Procedure

1. Confirm the audio system type by checking the Panel ID printed on the bottom-right or bottom-center of the machine.

Figure 1. Avalon, Avalon HV, Highlander, Highlander HV, Prius, Prius V, Sienna, Sequoia, Tacoma & Tundra.

Figure 2. 4Runner



#### Table 1. Panel ID Information

MODEL	Entune™ Audio	Entune™ Audio Plus	Entune™ Premium Audio
			510139 510140
			510141
			510142
4Runner	N/A	N/A	510143
			510144
			510145
			510146
			510147
Highlander,	N1/A	N1/A	510159
Highlander HV	N/A	IN/A	510160
	N/A		510153
Coqueio		510151 510152	510154
Sequoia			510155
			510156
	510100	510102	510103
Tacoma	510100		510161
		510102	510104
		510114	510118
Tundra	510113	510116	510119
Tunura	510115	510117	510120
		510117	510121
	NI/A	510120	510130
Avaion, Avaion nv	IN/A	510129	510131
Sienna	Ν/Δ	NI/A	510157
Sierina	N/A	IN/A	510158
Driue	510028	NI/A	510053
FIIUS	510020	IN/A	510054

#### Software Update Procedure (Continued)

Table 1. Panel ID Information (Continued)

MODEL	Entune™ Audio	Entune™ Audio Plus	Entune™ Premium Audio
			510164
Prius V	510163	N1/A	510165
		N/A	510166
			510167

- 2. Start the engine.
- 3. Go to the Setup screen.
  - A. For Entune<sup>™</sup> Audio: Press the SETUP button on the panel.



Figure 4. Tundra



B. For Entune <sup>™</sup> Audio Plus/Entune<sup>™</sup> Premium Audio: Press the APPS button on the panel.

Figure 5. 4Runner, Avalon, Avalon HV, Highlander, Highlander HV, Prius, Prius V, Sienna, Sequoia, Tacoma & Tundra



NOTE If Entune™ pop-up displays, select *OK*.

#### Figure 6. Tundra





### Software Update Procedure (Continued)

(1) Select Setup on the Apps Screen.



4. Select General on the Setup screen.



5. Select *Software Update* from the list on the *General Settings* screen.

#### HINT

Scroll down the list until *Software Update* is displayed.

#### Figure 10.



### Software Update Procedure (Continued)

6. Select *Update* on the *Software Update* Screen.

### Figure 11.

Software Update	
Update	
Update History	

### NOTE

If software has been detected properly, a "New software was found." pop-up will be displayed.

#### Figure 12.

oftware Update		🕷 al 🗎 🛍	
Model ID:13TDANNA-DA00	SAM ID: AE	AIBUVOE	Y
Hard No.:86100-0C090			
	Current	Now	
New softwar	e was found.		
Audio System :	000072		
Dsp Module :	520020		

7. Verify that the new software is up-to-date on the *Software Update* screen.

#### Figure 13.

Software Update		R 🛨	N
Model ID: 13TDANNA-DA00 Hard No.: 86100-0C100	SAM ID: A	EAIBXZPLQ	
	Current	New	-
Audio :	0101B1	XXXXXX	±
Audio System :	00007B	-	
Dsp Module :	520050	-	Ŧ
Detail Update Software			

### Software Update Procedure (Continued)

#### Table 2. Software Version Information

	Entune™ Audio		Entune™ Audio Plus		Entune™ Premium Audio	
ТҮРЕ	CURRENT VERSION	NEW VERSION	CURRENT VERSION	NEW VERSION	CURRENT VERSION	NEW VERSION
Audio	01013E	010144	010156 01015C	01015E	010170 010171 01017D	010182
Audio System	00008E	-	000093	-	000095	-
Dsp Module	910010	-	A10010	Ι	A10010	-
Sub	010001	-	010001	Ι	010001	-
Can	130209	_	130209	_	130209	_

8. Select Update Software on the Software Update screen.

#### Figure 14.

Software Update		R 📑	U		
Model ID:13TDANNA-DA00	SAM ID: AEAIBXZPLQ				
Hard No.:86100-0C100					
	Current	New	_		
Audio :	0101B1	XXXXXX	+		
Audio System :	00007B	_	Ŧ		
Dsp Module :	520050	-			
Detail	Updat	Update Software			

9. Select Yes on the "Would you like to start the software update?" pop-up.

#### Figure 15.



### Software Update Procedure (Continued)

10. The unit begins installation. The update will take about 10 minutes.

#### NOTE

- Do NOT turn off the engine or ACC before the software is ready for updating.
- Do NOT pull the USB Drive SST out of the vehicle USB port.





For Entune<sup>™</sup> Premium Audio:

If update fails and the error message "New software is not compatible with the system." displays, cycle the ignition OFF, remove the Map Micro SD Card from the head unit, and repeat steps 3 - 9.



### NOTE

Software update error is more likely to occur in areas with more traffic information.

Once update is complete, reinsert the Map Micro SD card into the head unit, cycle the ignition OFF, and proceed to step 10.

11. When "The software is ready for updating." displays, cycle the ignition OFF.



### Software Update Procedure (Continued)

12. Remove the USB Drive SST from the vehicle USB port.

#### **Software Version Confirmation**

- 1. Perform steps 3 6 of the Software Update procedure to re-enter the Software Update screen.
- 2. Verify that the software information is updated on the Software Update screen.

### Figure 19.



#### Table 3. New Software Version Information

ТҮРЕ	Entune™ Audio		Entune™ Audio Plus		Entune™ Premium Audio	
	CURRENT VERSION	NEW VERSION	CURRENT VERSION	NEW VERSION	CURRENT VERSION	NEW VERSION
Audio	010144	_	01015E	-	010182	-
Audio System	00008E	-	000093	-	000095	-
Dsp Module	910010	_	A10010	-	A10010	-
Sub	010001	-	010001	-	010001	-
Can	130209	_	130209	_	130209	_

\* Updated version information