

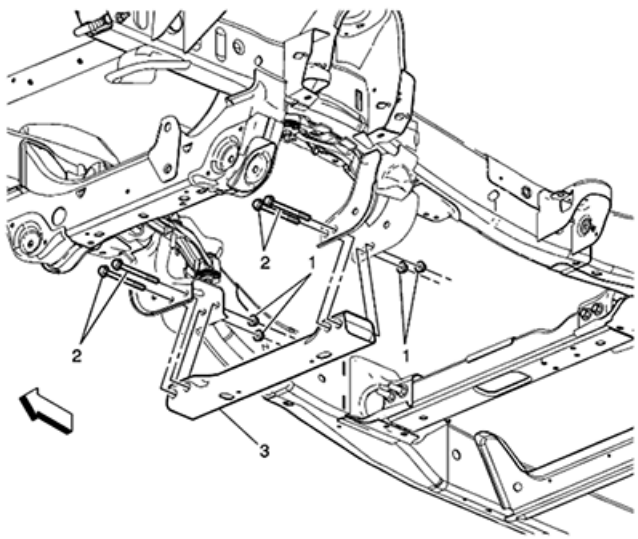


# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Creak Click Pop Crack Type Noise From Front Suspension/Frame Area While Making Turns

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2015	2017	All	All	All	All
Chevrolet	Silverado, Suburban, Tahoe	2015	2017	All	All	All	All
GMC	Sierra, Yukon Models	2015	2017	All	All	All	All

<b>Involved Region or Country</b>	North America
<b>Condition</b>	<p>Some owners may comment of a creak, click, pop, crack type noise from the front suspension or front frame area while making tight turns. It may also be noted the noise can be felt in the foot well area</p> 

### Correction

To correct this concern loosen and then retorque the four front frame crossmember bolts/nuts:

1. First Pass: 70 Nm (52 lb ft)
2. Final Pass: 110 degrees

## Warranty Information

Labor Operation	Description	Labor Time
1431720	Drivetrain and Front Suspension Frame Front Crossmember Replacement	Use Published Time

<b>Version</b>	1
<b>Modified</b>	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION