



Service Bulletin

INFORMATION

Subject: Various Engine Noises During Cold Start and Warm Engine Operation

Models: 2015 Cadillac Escalade, Escalade ESV
2016 Cadillac CTS-V
2014 Chevrolet Corvette
2014-2015 Chevrolet Silverado 1500
2015 Chevrolet Suburban, Tahoe
2016 Chevrolet Camaro
2014-2015 GMC Sierra 1500, Denali Models
2015 GMC Yukon, Yukon XL
Equipped with Engine RPO LV1, LV3, L83, L86, LT1 or LT4

Attention: This Bulletin also applies to any of the above models that may be Export vehicles.

This Bulletin has been revised to update the Models section. Please discard Corporate Bulletin Number 14-06-04-004B.

Information For Why New Engine Technologies Are Generating Noises

The latest generation of full size trucks and utilities incorporate a new generation of technologies not previously seen in full size truck and utility applications. As a result these engines generate noises during cold start and during warm operation that owners of previous generation multiport fuel injection (MPFI) vehicles may not be familiar with.

Direct Injection (DI) / High Pressure Fuel Pump / Fuel Injectors

The new Small Block Generation 5 engine family incorporates a new fuel system technology known as Direct Injection (DI). With DI, fuel is injected directly into the cylinder using a high pressure fuel system. DI provides many benefits in improving engine efficiency. In particular, DI improves power, torque, and most importantly fuel efficiency. This technology is included as standard equipment on all Generation 5 engines in the Small Block engine family which are the: 4.3L V6, 5.3L V8, and 6.2L V8.

The high pressure fuel system does have unique operating characteristics, in particular the noise emanating from the high pressure fuel pump can result in a subtle ticking noise that is apparent when the vehicle is idling. The sound is more evident when outside around the vehicle, when the hood is open or the vehicle is operated in a drive-through. The sound may be more noticeable during a cold start, but lessens once the engine is warm. A slightly higher pitched clicking sound is the fuel injectors pulsing **ON** and **OFF** under the high fuel pressures. These sounds are a normal characteristics of the DI high pressure fuel system.

Another operating characteristic is a slightly longer crank time when the engine is started. The increased crank time is the result of the time required to build high pressure in the fuel system before the engine starts.

Oil Pump Cold Start Rrrrp or Rasp

The oil pump design has changed from a gerotor gear type pump to a two speed vane type pump for fuel economy reasons. At temperatures of 32°F (0°C) or colder, when the engine has been sitting for a few hours it is possible to have air enter the pump through normal oil drainback. Upon startup the owner may hear a short Rrrrp or Rasp coming from the front of the engine. It is most often heard during a remote start. There is nothing wrong with the oil pump or oil system. No repairs should be attempted for this condition.

6.2L Engine – RPO LT1 Dry Sump Oil System Moan

The 6.2L engine (RPO LT1) dry sump oil system may generate a moan noise that may be heard inside the vehicle at idle and/or low engine rpm operation for approximately the first two minutes following a cold start. The noise cannot be heard from the outside of the vehicle.

This noise may be more noticeable on the passenger side of the vehicle and has been described as similar to the sound of running water. The dry sump oil system is hard mounted to the body of the vehicle and at cold start the oil moving through the system can transfer the noise to the body.

This is a normal dry sump oil system operating characteristic and no repairs should be attempted.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION