



Service Bulletin

TECHNICAL

Subject: Malfunction Indicator Lamp (MIL) Illuminated, DTC P2459 Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Cruze	2014	2015			Diesel (RPO LUZ)	

Condition	Some customers may comment on the Malfunction Indicator Lamp (MIL) being illuminated. The technician may find DTC P2459 set current or in history.
Cause	This condition may be caused by an increase in diesel particulates (soot) in the Diesel Particulate Filter (DPF).

Correction

1. Perform the repair procedure per Diagnostic Information and Procedures for the DTC set in SI.
2. Reprogram the ECM to prevent reoccurrence.
3. Perform a Regeneration Enable per Document ID: 2967525 in SI.

Warranty Information

For vehicles repaired under warranty, use appropriate labor operation for the repair performed. Submit Labor Operation 2881008 for Engine Control Module Reprogramming with SPS at 0.4 hr.

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION