

Product Upgrade Bulletin 161109REV



UPGRADE BULLETIN:
161109REV

YEAR(S) AFFECTED:
2017

PRODUCT(S) AFFECTED:
Fleetwood Storm;
Holiday Rambler
Vacationer XE

MODEL(S) AFFECTED:
All manufactured
prior to DC 17-18
and equipped with
Option 690 Neutral
Loss Protection

SUBJECT:
Installing a
Compressor Delay
Timer Relay

KEYWORDS:
Air conditioner,
Auto Generator
Start, delay, relay,
transfer switch

ISSUE DATE:
December 2016

The purpose of this product upgrade service bulletin is to inform all REV dealers of the need to add a Compressor Delay Timer Relay for the transfer switch to enable Auto Generator Start. A list of affected unit serial numbers appears at the end of this Bulletin.

CONDITION:

Due to over-sensitivity of the transfer switch, Auto Generator Start will not operate when the air conditioners are set to cool because the transfer switch will not allow the power from the generator through to the motor home.

CORRECTION:

Follow the steps below to add a Delay Relay to the Front Air Conditioner.

1. Park the motor home on dry, level pavement. Turn off the ignition and remove the key. Place the transmission in PARK and set the parking brake. Turn off the ignition and remove the ignition key. Maintain control of keys while work is performed.
2. Remove the chill grille from the ceiling at the front air conditioner to expose the duct work.
3. Install the new delay relay (part # 10078336) in the opening for the front roof air conditioner, above the supply duct. Fasten using the screws that come with the kit or by using headlock tape. See Figure 1.

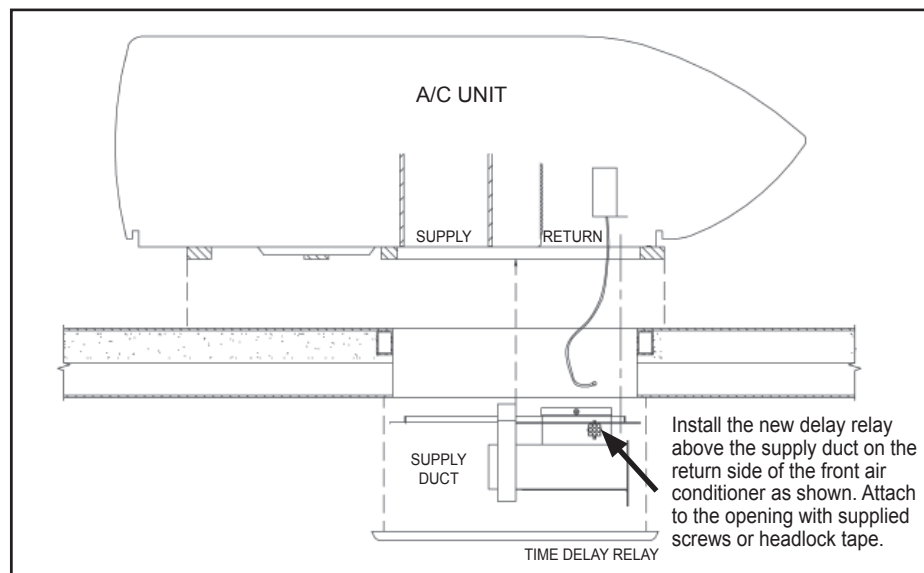


Figure 1

© 2016 REV Recreation Group Inc.

This bulletin is supplied for technical information only and is not an authorization for repairs.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

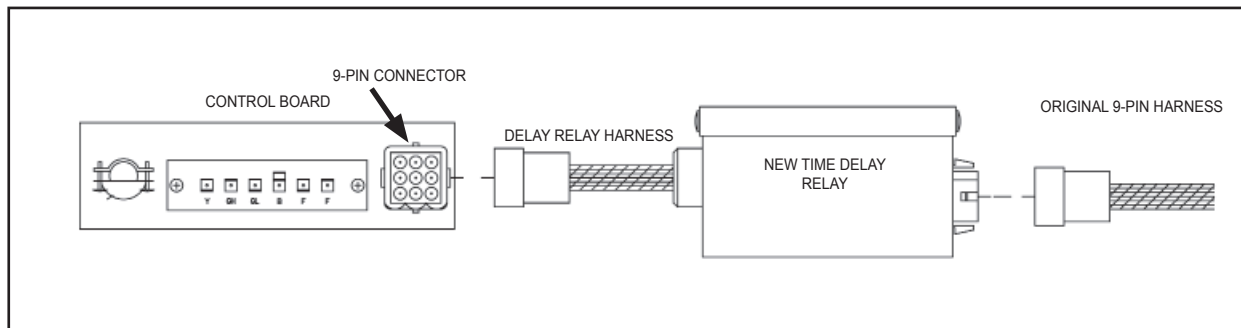


Figure 2

4. Unplug the 9-pin harness from the connection at the upper control board, and plug it into the 9-pin connector on the delay relay. See Figure 2.
5. Plug the harness for the new delay relay into the same connector from which the original 9-pin harness was unplugged in the previous step. See Figure 2.
6. Set the time delay setting on the new delay relay to 15 seconds; it may be adjusted as needed. See Figure 3.
7. Test operation of the system by starting the generator and listening for the sound of the air conditioner's compressor to turn on. Correct as necessary.
8. Reinstall the chill grille to complete the repair.

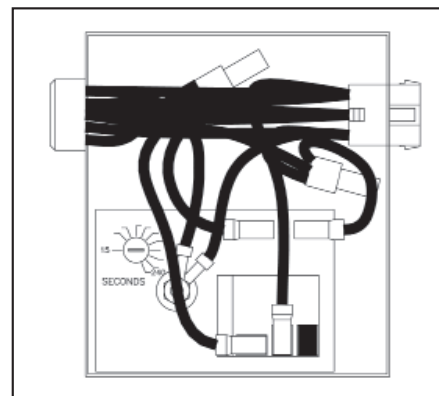


Figure 3

PARTS

<u>Part number</u>	<u>Description</u>	<u>Qty.</u>
10078336	Relay, Compressor Delay Timer	1

TOOLS

Screwdriver

WARRANTY LABOR ALLOWANCE:

Product Upgrade 161109REV - Delay Relay

Use Flat Rate Code:

6051-12 Product Upgrade 161109REV Inspected/Repaired

Time

0.3 hr.

If you have any questions regarding this Bulletin, contact
REV Recreation Group Dealer Technical Support:

Fleetwood Dealer Technical support: (800) 816-9825
Monaco/Holiday Rambler Dealer Technical Support (877) 332-9239

Service literature can be accessed online at: <http://revrvdealers.com>

This bulletin is supplied for technical information only and is not an authorization for repairs.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Product Upgrade Bulletin 161109REV - Affected Unit Serial Numbers (Fleetwood Brand)

2017 Fleetwood Storm

REV Unit Serial #	Chassis/VIN
785AH4423305	1F66F5DYXG0A10912
785AH4423890	1F66F5DY5G0A14768
785AH4423951	1F66F5DY3G0A15532
785AH4424079	1F66F5DY9G0A15535
785AH4424088	1F66F5DY1G0A15531
785AH4424097	1F66F5DYXG0A15527
785AH4424106	1F66F5DY0G0A15522
785AH4424126	1F66F5DY4H0A00863
785AH4424134	1F66F5DY1H0A00092
785AH4424223	1F66F5DY0H0A00858
785AH4424226	1F66F5DY9H0A00860
785AH4424230	1F66F5DY6H0A01691
785AH4424235	1F66F5DY7H0A01697
785AH4424287	1F66F5DY7H0A00095
785AH4424290	1F66F5DY3H0A01339
785AH4424310	1F66F5DY8G0A14764
785AH4424357	1F66F5DY3G0A14235
785AH4424360	1F66F5DY5G0A14236
785AH4424365	1F66F5DYXG0A14765
785AH4424368	1F66F5DY9H0A00857
785AH4424373	1F66F5DY6H0A00864

REV Unit Serial #	Chassis/VIN
785AH4424381	1F66F5DYXH0A00866
785AH4424427	1F66F5DY2H0A01347
785AH4424430	1F66F5DY1H0A01341
785AH4424438	1F66F5DY4H0A01348
785FH4424443	1F66F5DY4H0A02502
785AH4424451	1F66F5DYXH0A01693
785AH4424478	1F66F5DY5H0A01696
785AH4424483	1F66F5DY8H0A01692
785AH4424496	1F66F5DY5H0A00855
785DH4424550	1F66F5DY5H0A02492
785SH4424556	1F66F5DY6H0A02162
785SH4424570	1F66F5DY1H0A02814
785SH4424687	1F66F5DY6H0A03635
785DH4424688	1F66F5DY4H0A03634
785AH4424693	1F66F5DY2H0A00862
785SH4424711	1F66F5DY7H0A02168
785SH4424755	1F66F5DY6H0A03988
785SH4424763	1F66F5DYXH0A03637
785DH4424766	1F66F5DY3H0A03639
785SH4424771	1F66F5DYXH0A03993
785DH4424818	1F66F5DY0H0A03632

This bulletin is supplied for technical information only and is not an authorization for repairs.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Product Upgrade Bulletin 161109REV - Affected Unit Serial Numbers (Holiday Rambler Brand)

2017 Holiday Rambler Vacationer XE

REV Unit Serial #	Chassis/VIN
685AH4423395	1F66F5DY1G0A10913
685DH4423812	1F66F5DY0H0A00116
685AH4423903	1F66F5DY3G0A14767
685AH4423964	1F66F5DY4G0A15524
685SH4423976	1F66F5DY9H0A00115
685AH4424014	1F66F5DY2G0A15523
685AH4424072	1F66F5DY7G0A15534
685AH4424082	1F66F5DY5G0A15533
685AH4424095	1F66F5DY3G0A15529
685AH4424101	1F66F5DYXG0A15530
685AH4424198	1F66F5DY1G0A14766
685AH4424202	1F66F5DY9H0A00096
685AH4424207	1F66F5DY2H0A00859
685AH4424293	1F66F5DY3H0A01342
685AH4424301	1F66F5DYXH0A01340
685AH4424486	1F66F5DY0H0A00455
685AH4424501	1F66F5DY0H0A00861

REV Unit Serial #	Chassis/VIN
685FH4424503	1F66F5DY3H0A02815
685SH4424622	1F66F5DY4H0A01365
685AH4424644	1F66F5DY5H0A00094
685SH4424702	1F66F5DYXH0A01371
685DH4424757	1F66F5DY8H0A03636
685AH4424769	1F66F5DY4H0A00457
685SH4424812	1F66F5DY4H0A03987
685SH4424814	1F66F5DY1H0A03140
685AH4424820	1F66F5DY3H0A01695
685SH4424824	1F66F5DY1H0A03638
685SH4424828	1F66F5DY4H0A03990
685AH4424832	1F66F5DY2G0A14761
685AH4424834	1F66F5DY4H0A00460
685DH4424836	1F66F5DY1H0A04630
685DH4424839	1F66F5DY2H0A03633
685DH4424883	1F66F5DY8H0A03992
685DH4424884	1F66F5DY5H0A03142

This bulletin is supplied for technical information only and is not an authorization for repairs.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."