

	Date	Group	No.	Release	Page
This Field Service Bulletin (FSB) replaces PV729-FSB261-038_M (USA73582), "Cab Mounted Exhaust Bracket, Replacement" dated 05.2016.	5.2016	261	038	02	1(4)

Cab Mounted Exhaust Bracket, Replacement GU

FSB 261-038, Cab Mounted Exhaust Bracket, Replacement

(May 2016)

This Field Service Bulletin (FSB) references part numbers that are not currently available. This document will be released again in the near future.


GU MACK models equipped with cab mounted exhaust may experience excessive engine noise or vibration in the cab. In most cases, this is caused by a worn bushing in the cab mounted exhaust bracket. The bushing size has been increased to extend the life of the bushing.

Required Parts

- 22817713 — Pivot Bracket

Procedure

You must read and understand the precautions and guidelines in Service Information, Function Group 20, "Engine Safety Practices" before performing this procedure. If you are not properly trained and certified in this procedure, ask your supervisor for training before you perform it.

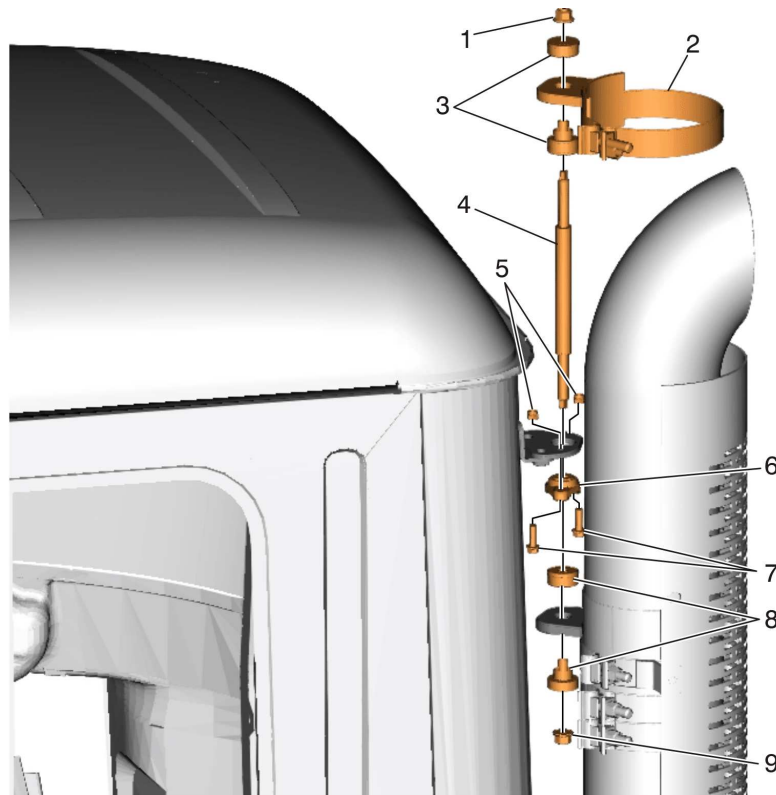

W2037578

- 3. EPDM Isolator
- 6. Spherical Slider Bushing
- 8. Bushings

- 1 Secure the vehicle for service by parking it on a flat level surface, applying the parking brake, chocking the rear wheels, and placing the transmission in neutral or park.
- 2 Remove the fasteners securing the rubber mount isolator rod at upper stack mount.
- 3 Remove the upper mounting strap and rubber mount. (Loosen top clamp, slide clamp up pipe and off isolator rod.)
- 4 Remove the rubber mount isolator rod from the spherical bearing.
- 5 Remove the spherical bearing from the mounting bracket.
- 6 Remove the rubber mounts from the upper and lower strap mounts.
- 7 Install the rubber mounts in the upper and lower strap mounts.
- 8 Install spherical bearing.

Note: Do not lubricate bearing pin. The spherical bearing is self-lubricating and does not require additional lubricant.

- 9 Install the rubber mount isolator rod and upper mounting strap.
- 10 Tighten the mounting fasteners for rubber mount isolator rod and tighten the mounting strap.
- 11 Start the engine and check for leaks.

Reimbursement

This repair may be eligible for reimbursement if a product failure was experienced within time and mileage limits of the applicable Warranty coverage. Reimbursement is obtained via the normal claim handling process.	Reimbursement UCHP
Claim Type (used only when uploading from the Dealer Bus. Sys.)	01
Labor Code	
Primary Labor Code	2618-03-09-01 — 0.3 hrs
Causal Part	21900242

Mack Trucks Inc. reserves the right to make any changes in design or to make additions to or upon its products without incurring any obligations to install the same on vehicles previously built.