	GROUP <b>BOD</b>	MODEL <b>2015-2017MY Sedona (YP)</b>
	NUMBER <b>158</b>	DATE <b>December 2016</b>
<b>TECHNICAL SERVICE BULLETIN</b>		
<b>SUBJECT:</b>	<b>2<sup>ND</sup> ROW STAND-UP SEAT LEVER MOUNTING BOLT REPLACEMENT (SA258)</b>	

This TSB provides information about how to replace the stand-up seat lever mounting bolt for the 2<sup>nd</sup> row seats on Sedona (YP) vehicles produced from July 21, 2014 through September 28, 2016. Vehicles built during this production date range may exhibit a condition where the lever mounting bolt on 2<sup>nd</sup> row outboard seats may become loose over time resulting in the inability to move the seat(s) to have easy access into and/or out of the 3<sup>rd</sup> row seats.

Follow the replacement procedure below to correct the condition.

**\* NOTICE**

**A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.**

**Repair status for a VIN is provided on WebDCS (Service> Warranty Coverage> Warranty Coverage Inquiry> Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs> Not Completed Recall> Recall VIN> Select Report), which includes a list of affected vehicles.**

**This issue number is SA258.**

Seal Lock Adhesive Added



**File Under: Body**

**Circulate To:**     **General Manager**     **Service Manager**     **Parts Manager**

**Service Advisors**     **Technicians**     **Body Shop Manager**     **Fleet Repair**

**SUBJECT: 2<sup>ND</sup> ROW STAND-UP SEAT LEVER MOUNTING BOLT REPLACEMENT**

**Bolt Replacement Procedure:**

1. Inspect and validate that the 2<sup>nd</sup> row seats are equipped with manual type stand-up seats as shown in the illustration on the right.

**\* NOTICE**


Apply the same service procedure for both LH and RH seats.



2. After confirmation, follow the service procedure below to replace the mounting bolt for the seat lever with an improved one.
3. Remove the seat lever cover (A) with an appropriate plastic trim removal tool.


**\* NOTICE**

Use a non-marring trim removal tool (such as Snap-on<sup>®</sup> Part Number PBN5 or equivalent).

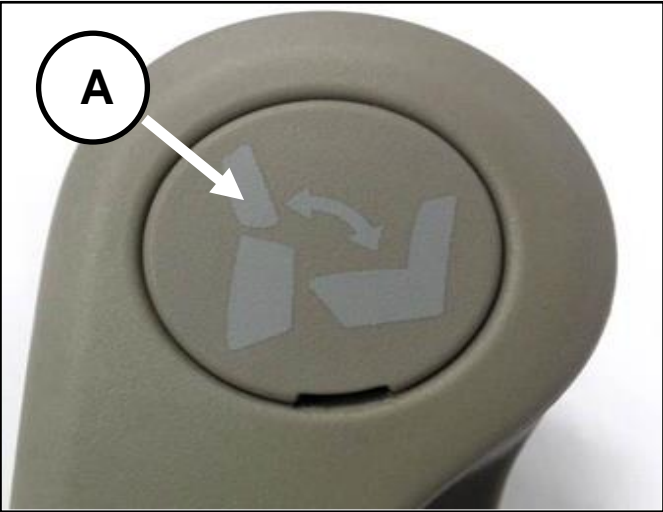

**SUBJECT:****2<sup>ND</sup> ROW STAND-UP SEAT LEVER MOUNTING  
BOLT REPLACEMENT**

4. Remove the seat lever mounting bolt (B) and discard.

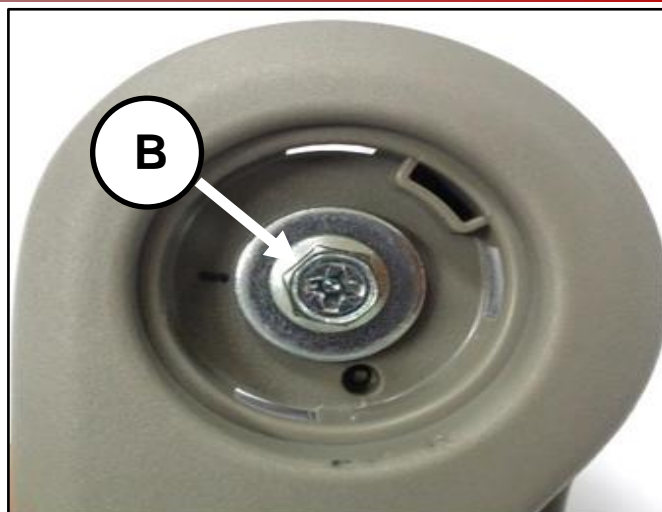

5. Install the new improved seat lever mounting bolt (C).


**Tightening Torque:**

3.6 ~ 4.3 lb-ft

(4.9 ~ 5.9 N.m 0.5 ~ 0.6 kgf.m,)

**\* NOTICE**

To ensure proper tightening, be sure to use a socket wrench when applying torque to the mounting bolt. **DO NOT** use a screwdriver.

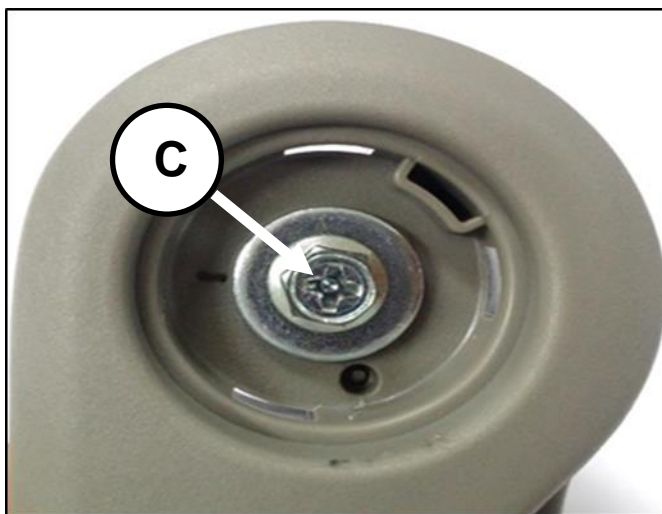

6. Re-install cover trim piece.  
7. Confirm lever operation


## AFFECTED VEHICLE RANGE:

Model	Production Date Range
Sedona (YP)	July 21, 2014 through September 28, 2016

SUBJECT:

## 2<sup>ND</sup> ROW STAND-UP SEAT LEVER MOUNTING BOLT REPLACEMENT

## REQUIRED PART:

Part Name	Part Number	Figure	Remarks	Qty
Stand-Up Seat Lever Mounting Bolt	89125 A9200QQK		Seal Lock Adhesive added	2

## WARRANTY INFORMATION:

Claim Type	Causal P/N	Qty	N Code	C Code	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty
V	12211 05123	0	N99	C99	(SA258) Replace seat lever mounting bolt on 2 <sup>nd</sup> row stand-up seat	160114R0	0.2 M/H	89125 A9200QQK	2