



Service Bulletin

INFORMATION

Subject: Diagnostic Tips for Brakes Dragging, Pull or Grab and/or ABS Light Illuminated

Attention: This Bulletin also applies to any of the models that may be Export vehicles.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Malibu (VIN Z)	2016	2016	SOP	GF199622	All	All

Condition	Some customers may comment that the brakes drag, pull or grab. The customer may also state that the ABS light is illuminated.
Cause	Brake Booster not returning and/or returning residual line pressure in system.

Correction

If you encounter a vehicle with the above concern, complete the following:

- Ensure brake drag is apparent at more than one corner.
- Either Disconnect vacuum supply and/or lift up slightly on brake pedal.
 - ⇒ If the condition goes away, replace the brake booster assembly. Refer to *Power Brake Booster Replacement* in SI.
 - ⇒ If the condition is still present, refer to SI for further diagnosis.

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION