



Countries: AUSTRALIA, BAHAMAS, BOLIVIA, BELIZE, CANADA, CHILE, TAIWAN, COLOMBIA, COSTA RICA, DOMINICAN REPUBLIC, ECUADOR, EL SALVADOR, TRINIDAD AND TOBAGO, UNITED STATES, URUGUAY, VENEZUELA, MEXICO, ARUBA, NICARAGUA, PERU, Curaçao, GUAM, GUATEMALA, GUYANA, HAITI, HONDURAS, JAMAICA, KOREA, SOUTH KOREA, PANAMA

Document ID: IK1201115

Availability: ISIS

Major System: ENGINES

Current Language: English

Other Languages: NONE

Viewed: 1361

Revision: 5

Created: 4/9/2014

Last Modified: 5/5/2016

Author: Mujtaba Aidroos

[Less Info](#)

Hide Details

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Edit Document	Provide Feedback	Helpful	Not Helpful
		 View My Bookmarks					 13	 3

Title: Maxxforce 11/13L, N13 and 2010+ Maxxforce 7 Cylinder Head Crack Inspection


Applies To: Maxxforce 11/13L, N13 and 2010+ Maxxforce 7 engines

CHANGE LOG

2016/05/04 - #3 is no longer acceptable
 2015/12/07 - Added more Keywords to search criteria based on comments from the field
 2015/11/09 - Updated to include 2010 Maxxforce V8
 2015/08/24 - Updated visibility
 2014/04/09 - Launch as internal release only

DESCRIPTION

MF 11/13, N13 and MF7 Cylinder Head Crack Inspection Guide

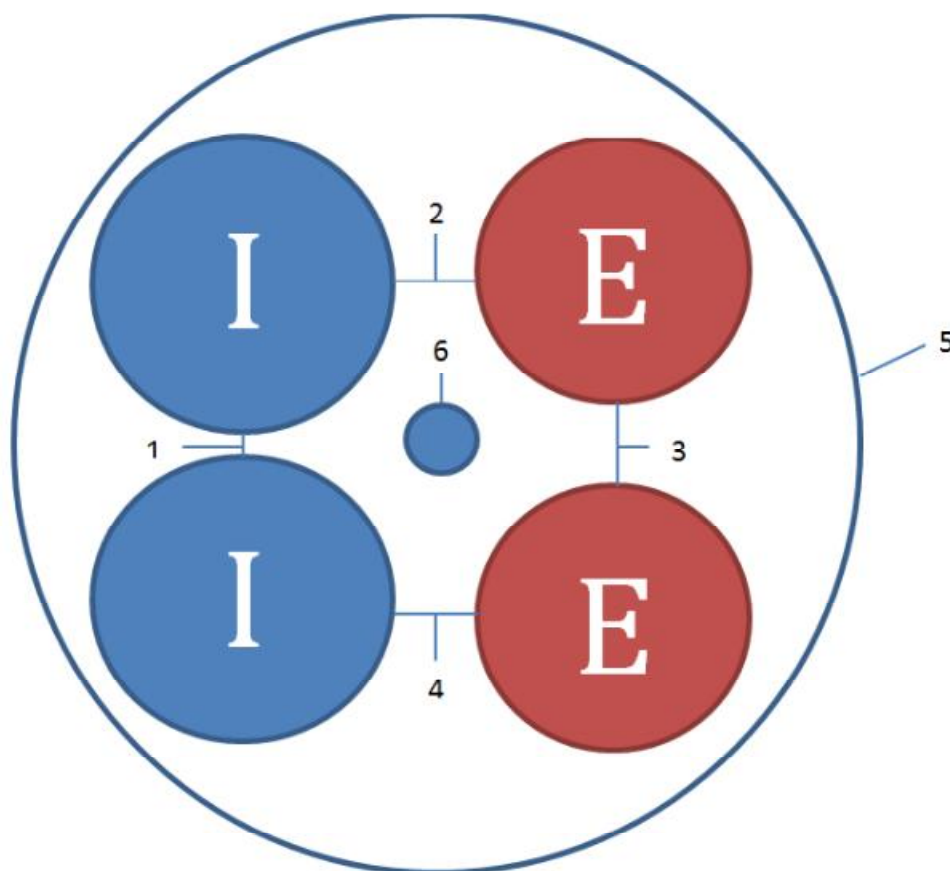

Acceptable Cracks

- Cracks of any length in location 1, between the intake ports, are acceptable
- Cracks of less than 3 mm length from location 6, Injector bore are acceptable
- Cracks between locations 2 & 4 are only acceptable if they are less than 3mm in length and do not contact the valve seat
- Cracks that appear on the surface of the fire deck and are less than 3mm in length; including cracks emanating from valve seats but not between valves

Unacceptable cracks

- Any cracks that run the entire length between the ports in locations 2, 3, & 4 are unacceptable and cylinder head replacement is needed
- Any cracks, regardless of length, that run along the combustion sealing surface, location 5, are unacceptable and cylinder head replacement is needed
- If there are multiple cracks propagating from a single valve seat, cylinder head replacement is needed
- If there are cracks in multiple locations 1-4, on any single cylinder, cylinder head replacement is needed

WARRANTY INFORMATION

Warranty Claim Coding:

Group:	12000 - Engine
---------------	-----------------------

Noun: 342 - Head, Cylinder

 Hide Details

Feedback Information

Viewed: 1360

Helpful: 13

Not Helpful: 3

No Feedback Found

Copyright © 2016 Navistar, Inc.