

SERVICE MANUAL INFORMATION

Group:	SERVICE MANUAL UPDATE
Bulletin No:	SB-16-010
Issue Date:	4-18-2015
Ref. No.	SB-A-11-078

Subject: CORRECTION OF WORKSHOP MANUAL FOR 2008MY-2017MY Correction of the Inspection of the DPR Filter

RELEVANT MODEL: 2008MY-2017MY Hino Trucks

The following is to inform you of the above caption. This service data should be attached to the relevant pages of the workshop manuals for maintenance and to use for servicing.

OVERVIEW:

Correction of the inspection of the DPR filter.


3 INSPECT THE DPR FILTER WITH THE DEDICATED CHECK PROBE.

1. Insert the check probe from the rear surface to inspect the inside.

SST: BOSCH part No. HDT650590
FILTER GAUGE ASSEMBLY

⚠ CAUTION

- DPR filter internal wall may be damaged if the check probe is significantly bent or skewed. Repair or replace the check probe.
- Do not force the check probe into the DPR filter or push the check probe past the DPR filter length, otherwise DPR filter may be damaged.

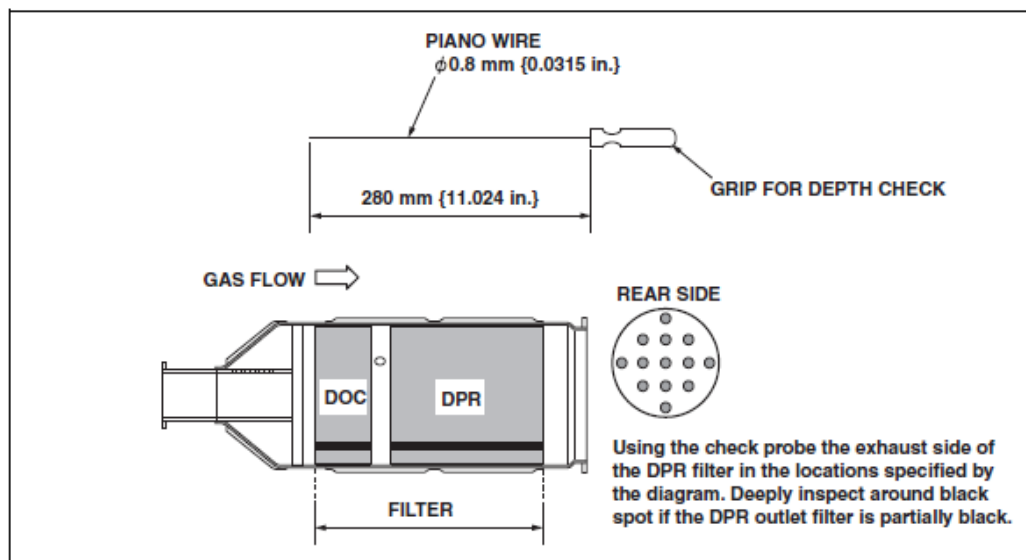

CHANGE



A Toyota Group Company

SERVICE MANUAL INFORMATION

Group:	SERVICE MANUAL UPDATE
Bulletin No:	SB-16-010
Issue Date:	4-18-2015
Ref. No.	SB-A-11-078

ADD

2. Does the check probe reach the desired depth?

Unit: mm (in.)

Relevant models	Standard value (Desired depth)
2008-2010MY (HINO 145, 165, 185, 238, 258, 268, 308, 338)	237.5-250.5 {9.351-9.862}
2008-2017MY (HINO 155, 195, 155h, 195h)	
2011-2017MY (HINO 238, 258, 268, 338, 358)	175.9-184.9 {6.926-7.279}

NO

Replace with a new DPR filter and new ^{*}PM sensor, and install them on the vehicle.

Reference: EXHAUST , DPR CLEANER, REPLACEMENT, MOUNTING DPR CLEANER (Page 11-39)

YES

*If so equipped


CHANGE

DPR filter is normal, clean the tail pipe and then install it on the vehicle.

Reference: EXHAUST , DPR CLEANER, REPLACEMENT, MOUNTING DPR CLEANER (Page 11-39)

AIR CLEANING FLOW

EN01F02127100402002010

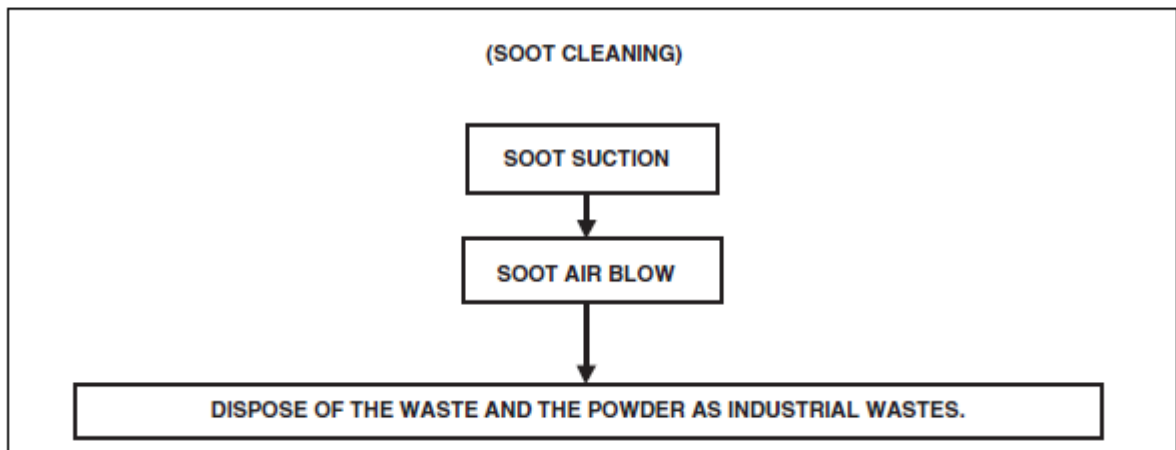

SHT8021271000063



A Toyota Group Company