

Technical Service Bulletin



90 Instrument cluster analog needles do not sweep after switching on ignition

90 16 63 2043505/1 February 26, 2016.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
S3	2015	All	Not Applicable

Condition

The analog needles in the cluster do not always perform a full sweep when the ignition is turned on. This condition is sporadic.

Technical Background

An error in the cluster software created the sporadic condition.

Production Solution

New cluster software was introduced into series production.

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the instrument cluster control module, J285 (address word 17), using the SVM action code as listed in the table below, if necessary.

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
S3 sedan	8V0920970S	4290 4291 4292	8V0920970S	4312	17A018

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9025		
Damage Code:	0039		
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 120 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2043505/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB (2043505) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.