



# Service Bulletin

File in Section: -

Bulletin No.: 16-NA-281

Date: September, 2016


## TECHNICAL

**Subject:** Service Advanced Forward Lighting Message Displayed, Malfunction Indicator Light (MIL) Illuminated

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Cascada	2016	2016				

<b>Involved Region or Country</b>	North America
<b>Condition</b>	Some customers may comment on the following conditions: <ul style="list-style-type: none"><li>• Service Advanced Forward Lighting message displayed in the DIC.</li><li>• Malfunction Indicator Light (MIL) Illuminated.</li></ul> The Technician may find DTC B3410 set.
<b>Cause</b>	A weak solder joint to the printed circuit board in the front level sensor may be causing an intermittent connection.

**Correction**

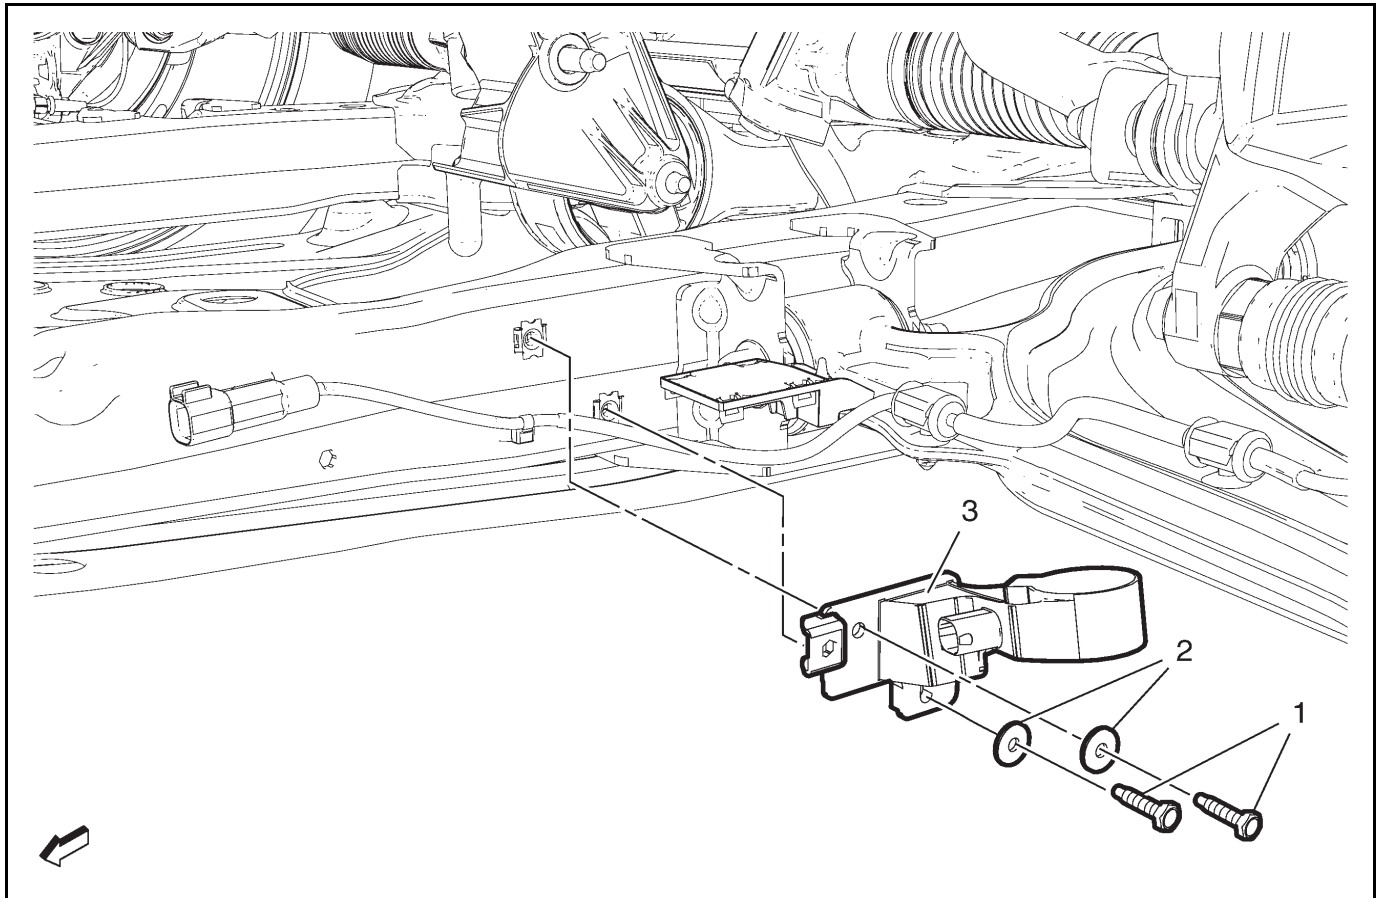

2190255

If the front headlamp leveling sensor (3) has been found to be the cause for the customer concern, the leveling sensor must be replaced.

**Service Procedure**

Refer to *Headlamp Leveling Front Suspension Height Sensor Replacement* in SI.

**Parts Information**

Description	Part Number	Qty
SENSOR, FRT SUSP AUTO FWD LIGHTING POSN	12845300	1

Version	1
Modified	

**Warranty Information**

Labor Operation	Description	Labor Time
2042980	Headlamp Leveling Front Suspension Height Sensor Replacement	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY  
TECHNICIAN  
CERTIFICATION