



Service Bulletin

File in Section: -


Bulletin No.: 16-NA-289

Date: September, 2016

TECHNICAL

Subject: Front Seat Back Cover Material Pulling Loose Around Easy Entry Release Handle


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro	2016	2017			All	All

Involved Region or Country	North America and N.A. Export Regions
Condition	 <p style="text-align: right; font-size: small;">4581014</p> <p>Some customers may comment that the cover material on the driver or passenger seat back is pulling loose around the easy entry release handle bezel. Examples of a cloth and leather seat cover are shown in the graphic above.</p>
Cause	The cause of the condition may be that the cover material is currently not secured underneath the handle.

Correction

Install a push pin (referenced in the part table below) to secure the cover material to the underside plastic retainer following the Service Procedure below.

Service Procedure

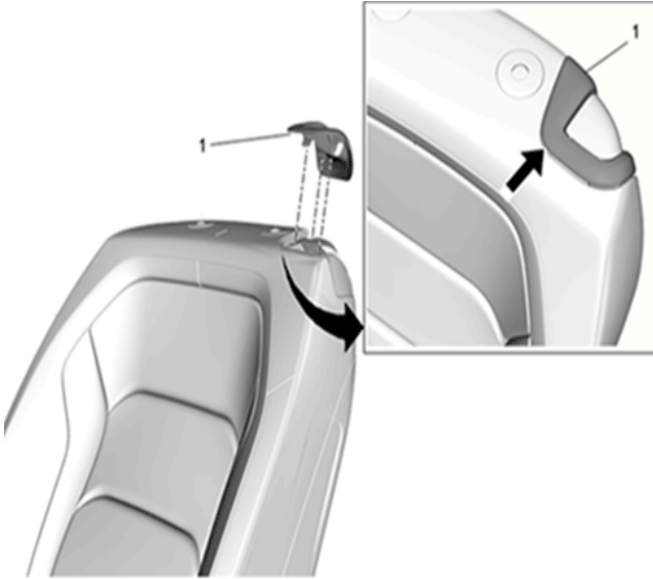

4571158


Note: Graphics of this repair show the driver seat. Passenger seat would be similar.

1. Carefully remove the front seat back latch release handle bezel (1) on the affected seat. Refer to *Front Seat Back Latch Release Handle Bezel Replacement* in SI.



4581015

2. Reposition the seat cover material to align with edge of plastic retainer (1).

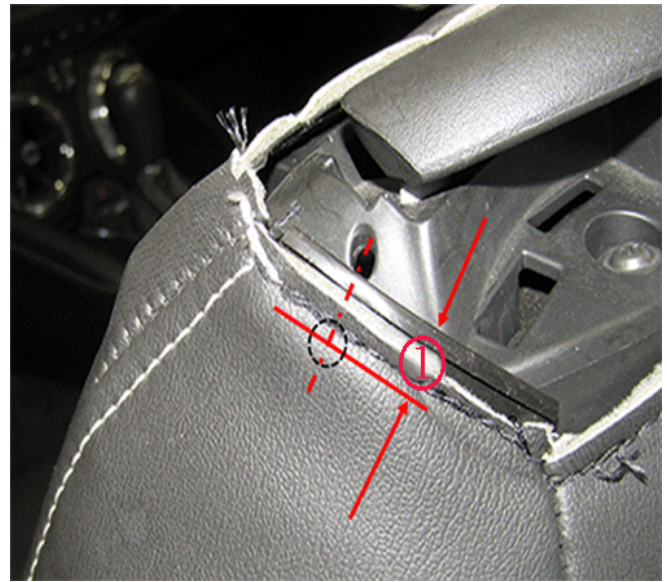

4581017

3. Mark a location on the material approximately 5 mm (1) from the inboard edge of the plastic retainer, and in-line with the existing hole in the handle base.



4581018

4. Using a 4.0 mm hole punch, punch a hole through BOTH the cover material and the plastic retainer (1).



4581019

5. Install the push pin securing the material to the plastic retainer.



4581020

6. Then, pulling the material and retainer farther upward, install the push pin in the existing hole of the handle base.



4581021

7. Reinstall the front seat back latch release handle bezel. Refer to *Front Seat Back Latch Release Handle Bezel Replacement* in SI.
8. With the bezel reinstalled, squeeze the outboard, upper seat cushion to ensure the containment is robust.

Parts Information

Description	Part Number	Qty
RETAINER-R/CON DR LK RCVR	10063599	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
7080358	Add Push Pin to Secure Seat Back Material	0.3 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION