



# Service Bulletin

File in Section: -

Bulletin No.: 16-NA-293

Date: September, 2016

## TECHNICAL

**Subject:** Folding Top Leans to One Side During Top Cycle

**This Bulletin replaces PIC5885. Please discard PIC5885.**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro	2011	2015			All	All

Involved Region or Country	North America and N.A. Export Regions
Additional Options (RPO)	Equipped with Convertible Top
Condition	Some customers may comment that the convertible folding top leans to one side when opening or closing the roof.
Cause	This may be due to a ball socket that has separated from either the left or right hydraulic cylinder.

### Correction

If you encounter a vehicle with the above concern, inspect the hydraulic cylinders for proper attachment to the folding top frame assembly.

If the cylinder has separated from the folding top frame, replace the retainer and reinstall the cylinder to the frame assembly.

### Parts Information

Description	Part Number	Qty
Clip	11611829	As Needed

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
6080028*	Replace Folding Top Cylinder Retainer/Clip	0.5 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

Copyright 2016 General Motors LLC. All Rights Reserved.



**WE SUPPORT VOLUNTARY  
TECHNICIAN  
CERTIFICATION**