



Service Bulletin

File in Section: -

Bulletin No.: 16-NA-300

Date: September, 2016

TECHNICAL

Subject: Heated Ventilated Seat and Indicator Light Inoperative

Brand:	Model:	Model Year:		Vehicles Build Date:		Engine:	Transmission:
		from	to	from	prior to		
Cadillac	XT5	2017	2017	SOP	Sept. 2, 2016		

Involved Region or Country	North America and N.A. Export Regions
Condition	Some customers may comment on the following conditions: <ul style="list-style-type: none"> • Heated ventilated seats not working. • Indicator light not coming on. The Technician may find the following codes set: <ul style="list-style-type: none"> • U1520 • U1524 • U1526
Cause	This condition may be caused by a loss of communication between the BCM and the heated seat controller on the LIN communication line.

Correction

If you encounter a vehicle with the above concerns, the Body Control Module needs to be updated with the latest calibrations.

Service Procedure

Refer to *Body Control Module Reprogramming with SPS* in SI.

Warranty Information

Labor Operation	Description	Labor Time
2810215	Body Control Module Reprogramming with SPS	Use Published Labor Operation Time

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION