



Service Bulletin

File in Section: -

Bulletin No.: 16-NA-318

Date: September, 2016


TECHNICAL

Subject: Hard to Steer in Colder Temperatures and/or Knocking/Clicking Noise Heard

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Encore	2013	2016			All	All
Chevrolet	Trax	2013	2016			All	All

Involved Region or Country	North America
Condition	Some customers may comment on a hard steer during colder temperatures and/or knocking/clicking noise heard.
Cause	This condition may be due to water intrusion in the steering gear input shaft freezing and/or causing corrosion.
Additional Options	Equipped with Steering-Power, Non-Variable Ratio, Electric (RPO NJ1)

Correction

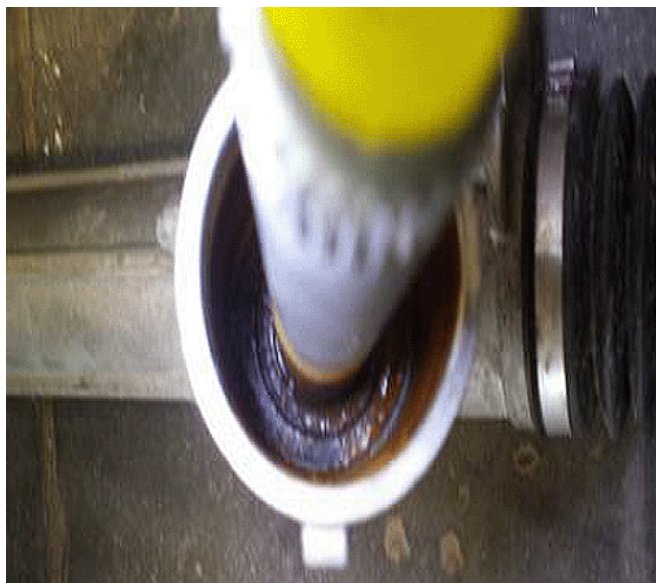

4355408



4355420

Check for water intrusion and corrosion at the power steering gear pinion housing. A small amount of rust spots are normal such as one or two small red rust spots.

If water intrusion and/or more than 1 or 2 rust spots is detected, replace both the intermediate steering shaft boots (seals) and the steering gear.

Service Procedure

Inspect the intermediate shaft and make sure the joint is not coming in contact with the steering rack boot (seal). If needed, adjust the boot (seal) with the proper clearance between the shaft and boot. Refer to *Intermediate Steering Shaft Upper Seal and Steering Gear Replacement (NJ1 With MNH or MNK)* in SI.

Parts Information

Description	Part Number	Qty
GEAR ASM-R/ PINION STRG	94537908	1
BOOT ASM-INTER STRG SHF	42441277	1
BOOT ASM-INTER STRG SHF INR	42441278	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
7480198*	Replacing Both Inner and Outer Intermediate Steering Shaft Boots and Steering Gear	2.0 hrs
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	