



Service Bulletin

PRELIMINARY INFORMATION

Subject: DTC P20E8 Reductant Low Pressure

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Colorado	2016	2016	All	All	2.8 LWN	All
GMC	Canyon	2016	2016	All	All	2.8 LWN	All

Involved Region or Country	North America
Additional RPO/s:	N/A
Condition	A dealer may encounter a customer concern of "Service Emission System" or "Service Exhaust Fluid System" warning messages on the Driver's Information Center (DIC). Diagnostics may show DTC P20E8 - Reductant Low Pressure has set.
Cause	Complete the current SI diagnostic for any trouble code or symptom found.

Correction

If DTC P20E8 is a current / active DTC; complete the repair as directed by the DTC P20E8 flow chart.

If DTC P20E8 is found to be intermittent and cannot be duplicated; inspect the part number of the Diesel Exhaust Fluid (DEF) pump.

If the DEF pump part number is not 84148452; replace the pump.



In the example above the part number is 23334618.

Parts Information

Part Number	Description	Qty
84148453	MODULE KIT, EMIS RDCN FLUID SPLY PUMP	1

Warranty Information

Labor Operation	Description	Labor Time
4029820	Emission Reduction Fluid Supply Pump Module Replacement	Use Published Labor Operation Time

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION