

Technical Service Bulletin

| GROUP | NUMBER |
|------------------|---------------|
| CAMPAIGN | 16-01-056 |
| DATE | MODEL(S) |
| NOVEMBER 2016 | VELOSTER (FS) |

SUBJECT:

VELOSTER (FS) TCM ONLY DCT CONTROL LOGIC UPDATE (SERVICE CAMPAIGN T1A)



ECU Update

* IMPORTANT

*** Dealer Stock and Retail Vehicles ***

Dealers must perform this Service Campaign on all affected vehicles prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair.

When a vehicle arrives at the Service Department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.

Description:

This bulletin provides the procedure to update the TCM (Transmission Control Module) on some 2017 Hyundai Velosters equipped with a 7-speed EcoShift® Dual Clutch Transmission (DCT). The update will address:

• A slight hesitation at low speeds that can be experienced in certain driving conditions. This update improves the low speed engine and transmission response.

Applicable Vehicles: Certain 2017 Veloster (FS) with 1.6T engine 7-speed DCT Transmission

GDS Information: System Selection: DCT

| Event # | Description | |
|---------|--|--|
| 422* | FS 1.6T 7DCT CONTROL LOGIC IMPROVEMENT | |

(*or use a later available event as listed in the GDS ECU Update screen if one is available.)

Warranty Information:

| Model | Op Code | Operation | Op Time |
|---------------|----------|------------|---------|
| Veloster (FS) | 60C099R1 | TCM UPDATE | 0.3 M/H |

NOTE: Submit claims on Campaign Claim Entry Screen.

NOTICE

You must initially perform GDS TCM Update in Auto Mode.

- If the TCM Update starts but then fails in Auto Mode, perform the update in Manual Mode to recover.
- Refer to the General Instructions found in TSB: 15-GI-001 (GDS Mobile) and 15-GI-002 (PC GDS).

TCM ROM ID Table:

| Model | TCM P/N | CAL | ID |
|----------------------------------|-------------|---|------------|
| Wodei | | OLD | NEW |
| Veloster (FS) 1.6T-GDI DCT | 95440-2D400 | DFS0T16NS0 DFS0T16NS1 DFS0T16NS2 DFS0T16NS3 DFS0T16NS4 DFS0T16NS5 DFS0T16NS6 DFS0T16NS7 DFS0T16NS8 DFS0T16NS8 DFS0T16NS9 DFS0T16NSA | DFS0T16NSB |

TCM Manual Mode Password Information Table:

| Menu | Password |
|-----------------------------------|----------|
| FS 1.6T-GDI TCM (DCT) 95440-2D400 | 2400 |

Service Procedure:

- 1. Perform service procedure outlined in this TSB.
- 2. Check for Diagnostic Trouble Codes in the ALL menus and erase any DTC.
- 3. Erase the DTC in the BlueLink system according to TSB 12-BE-005-2.
- 4. Confirm normal vehicle operation.

TSB #: 16-01-056 Page 2 of 2