

Classification:

EM16-007

Reference:

ITB16-044

Date:

November 3, 2016

## 2016-2017 Q50, 2017 Q60, AND 2017 QX30 WITH 2.0L TURBO ENGINE; CARTRIDGE-STYLE OIL FILTER

**APPLIED VEHICLES:**            2016-2017 Q50 (V37)  
                                          2017 Q60 (V37)  
                                          2017 QX30 (H15)

**APPLIED ENGINE:**            2.0L Turbo

### SERVICE INFORMATION

- The Applied Vehicles are equipped with a cartridge-style oil filter.
- The filter may be difficult to remove. If this should occur, pull the filter straight off with no bending (if the filter rotates with the housing).
- The filter housing may be damaged or broken if not handled with care.
- If the filter housing is damaged or broken, it must be replaced.

#### NOTE:

- If the tip of the filter housing breaks off inside the front cover of the engine, use needle-nose pliers to remove the piece(s) to prevent debris from entering the oil passages when the engine is started.
- If a replacement filter housing is needed, make sure to lubricate the o-rings and neck of the filter housing prior to installation.



Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti retailer to determine if this applies to your vehicle.