

Technical Information

Service

30/16 ENU 9110

9

Eliminating Symptoms in Body Interior: Re-coding PCM 4.0 (with Connect Plus) ("Apple CarPlay" does not work/SY3016)

General information

Model Lines: Macan (95B) Series

Model Year: As of 2017

Equipment: PCM 4.0 with Connect Plus (I-no. 9WU)

Symptom Customers complain that "Apple CarPlay" does not work. "Apple CarPlay" is **not displayed** in the

Connection Manager.

Cause: Incorrect coding of vehicle data.

The coding "9WU" = MIRRORLINK + RSE PREPARATION was set at the factory.

"Apple CarPlay" works when the coding is changed to "9WT" = MIRRORLINK (CARPLAY/GAL).

Date of

Work

The coding was changed during production from May 30, 2016.

Introduction:

Use 9900 - PIWIS Tester III with software version 33.010.030 installed to change the vehicle data

Procedure: coding from **9WU** to **9WT**:

⇒ Select the "Automatic coding" function in the 'Codings/adaptations' menu and confirm your

selection by pressing •F12".

Invoicing: For invoicing and documentation using PQIS, enter the following coding:

Location (FES5)	91100	Front display + operator control unit		
Damage type (SA4)	1614	Function not as specified		

9110 ENU **30/16**

Technical Information

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safety. If a particular condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your authorized Porsche Dealer for the latest information about whether a particular technical bulletin applies to your vehicle. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify the current and correct part numbers. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

Dealership Distribution Routing	Service Manager	 Shop Foreman	 Service Technician	 	
	Asst. Manager	 Warranty Admin.	 Service Technician	 	

Dr. Ing. h.c. F. Porsche AG is the owner of numerous trademarks, both registered and unregistered, including without limitation the Porsche Crest®, Porsche®, Boxster®, Carrera®, Cayenne®, Cayman®, Macan®, Panamera®, Speedster®, Spyder®, 918 Spyder®, Tiptronic®, VarioCam®, PCM®, PDM®, 911®, RS®, 4S®, FOUR, UNCOMPROMISED®, and the model numbers and the distinctive shapes of the Porsche automobiles such as, the federally registered 911 and Boxster automobiles. The third party trademarks contained herein are the properties of their respective owners. Porsche Cars North America, Inc. believes the specifications to be correct at the time of printing. Specifications, performance standards, standard equipment, options, and other elements shown are subject to change without notice. Some options may be unavailable when a car is built. Some vehicles may be shown with non-U.S. equipment. The information contained herein is for internal authorized Porsche dealer use only and cannot be copied or distributed. Porsche recommends seat belt usage and observance of traffic laws at all times.

Oct 13, 2016 Page 2 of 2