

1/13/16 MY11 LC, LD, LX

MY12, 13 LD

GPOP - Issue Review System

Part Number: 04584559A\$, 04584560A\$, 04584563A\$, 04584564A\$, 04584568A\$, 04584569A\$,
04584571A\$, 04584572A\$, 04584573A\$, 05181618A\$, 05181778A\$, 68059524A\$,
68059643A\$, 68078363A\$, 68078545A\$

Part Description: Steering Gears, Pumps and Hoses

Issue Description: This tech tip applies to vehicles built before 12-23-2010, these vehicles can exhibit a squeak or rubbing noise when turning the steering wheel. Do not replace the steering gear, steering pump, power steering pressure hose or power steering return hose before investigating the dash seal ring. The source of the noise may be the sealing ring under the dash seal. To correct the issue apply MOPAR product part number 04318070AD (Silicone Spray Lube) to the inner dash seal interface and also the outer engine compartment interface. Do not use any alternate lubricants. If MOPAR product part number 04318070AD (Silicone Spray Lube) is not available then replace the assembly. Refer to TSB 08-091-14.

~ _____ ~
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquires. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.