

Special Bulletin

SP16-303C

Date	Expiration	Release	Page
02.2016	02.2018	1	1(3)

Rev. C This document supersedes previous revisions.

June 21, 2016 Added vehicles following production retrofit transfer

WHEELCHAIR LIFT CABLE WEAR

Prevost vehicles

DESCRIPTION

On the vehicles affected by this bulletin, reposition the harness out of the path of an unlocked electrical box door.

MODEL YEAR(S) AND VEHICLES INVOLVED

NOTICE TO SERVICE CENTERS		
Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.		
Model	VIN	Unit numbers
X3-45 Commuter Model Year : 2015 - 2016	The following individual vehicles 4RKG33499 <u>G9737292</u> , 4RKG33490 <u>G9737293</u> , 4RKG33492 <u>G9737294</u> And from 4RKG33497 <u>F9737001</u> up to 4RKG33491 <u>G9737240</u> incl.	2782, 2783, 2784 And from 2492 to 2731 incl.
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.		

MATERIAL NEEDED

Order kit SP16-303 which includes the following parts:

Part No.	Description	Qty
504637	Cable tie	1
504751	Rotary spacer	1

Other parts that may be required:

Part No.	Description	Qty
680319	Electrical tape	1

Date	Expiration	Release	Page
02.2016	02.2018	1	2(3)

NOTE

Material can be obtained through regular channels.

PROCEDURE**DANGER**

Park vehicle safely, apply parking brake, stop engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.

- 1) On the WCL control box of the WCL unit:
- 2) Add electric tape 680319 on the cable sheath to secure the electrical wires inside.
- 3) Add a rotary spacer 504751 on the cable over the electric tape.
- 4) Secure with cable tie 504637 qty 1

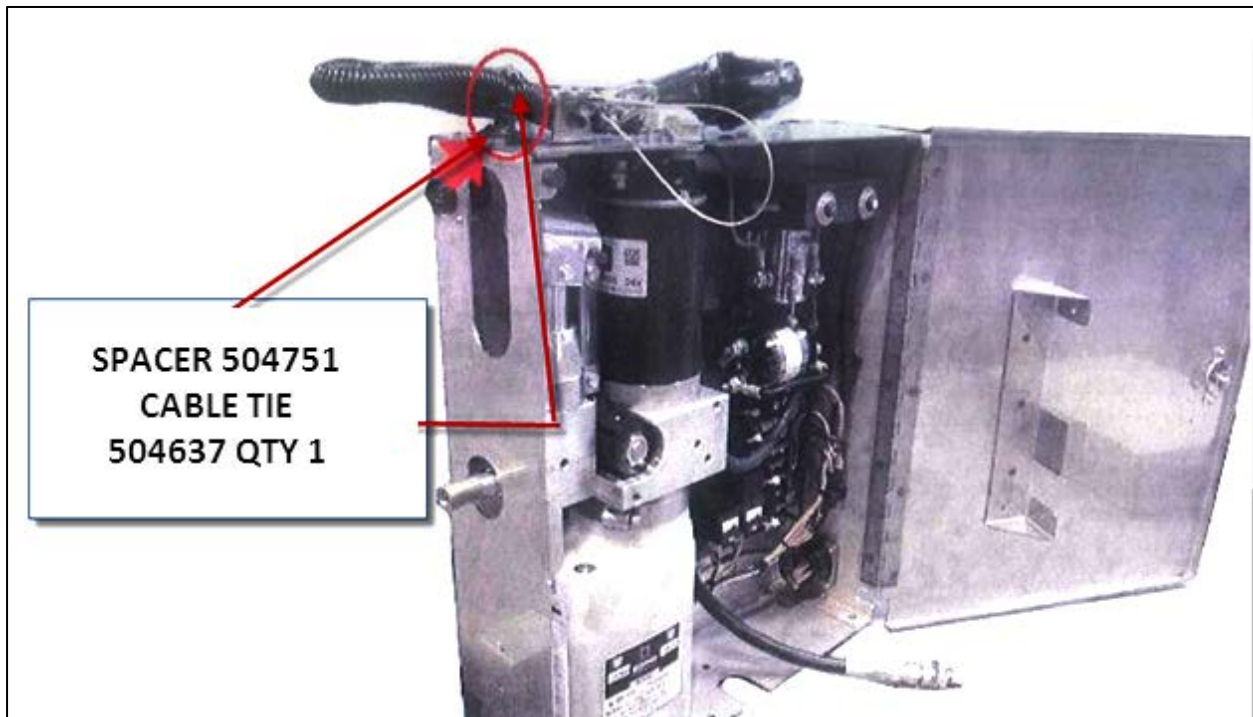


Figure 1

Date	Expiration	Release	Page
02.2016	02.2018	1	3(3)

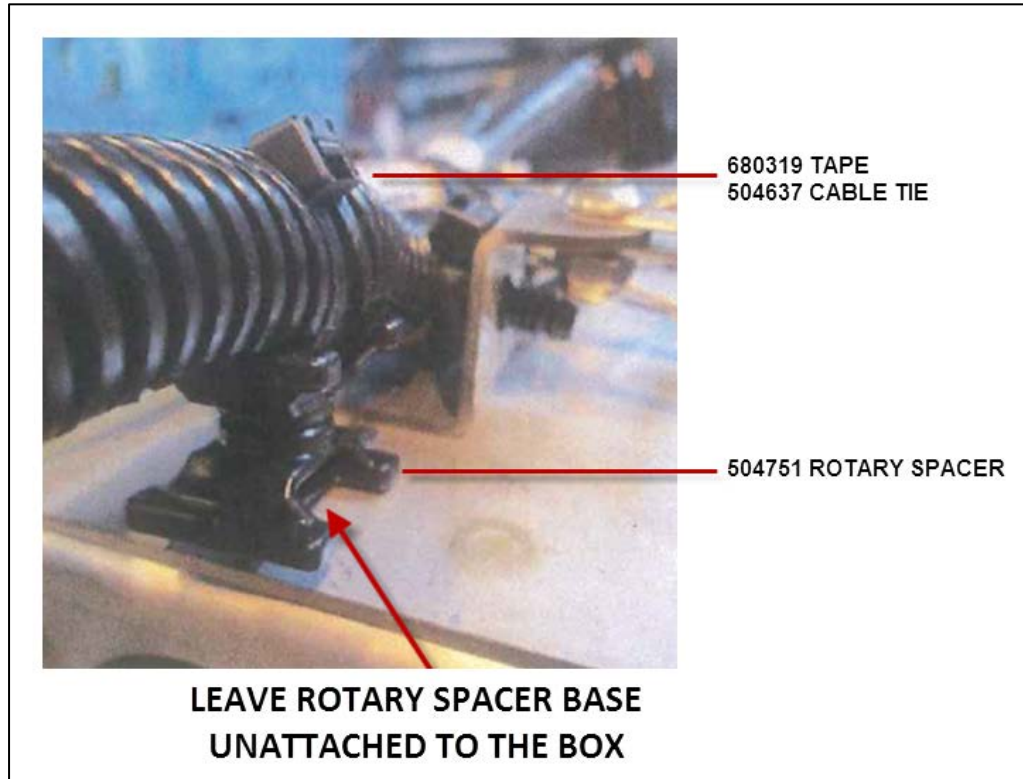


Figure 2

PARTS / WASTE DISPOSAL

Return replaced parts to Prevost with A.F.A. for full reimbursement.
Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

ESTIMATED TIME

The time required to perform this special bulletin is approximately 15 minutes.

OTHER

VBC Bulletin	N/A
Fail Code	25.00
Defect Code	09
System Condition	B
Causal Part	491244P

Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Prevost, however, is not committed to, or liable for updating existing products.