



SERVICE BULLETIN

Classification:

AT16-003a

Reference:

NTB16-045a

Date:

November 11, 2016

2016-2017 TITAN XD; 7 A/T DTCs STORED

This bulletin has been amended to update Applied Vehicles.
Please discard previous versions of this bulletin.

APPLIED VEHICLES: 2016-2017 Titan XD (A61)
APPLIED TRANSMISSION: RE7R01B (7 A/T – 7 speed)
APPLIED ENGINE: VK56VD (V8 Gasoline)

SERVICE INFORMATION

IMPORTANT: If you confirm one or more of the following transmission DTCs are stored:

P0729: 6GR Incorrect Ratio
P0730: Incorrect Gear Ratio
P0731: 1GR Incorrect Ratio
P0732: 2GR Incorrect Ratio
P0733: 3GR Incorrect Ratio
P0734: 4GR Incorrect Ratio
P0735: 5GR Incorrect Ratio
P1734: 7GR Incorrect Ratio

Before performing any transmission repairs:

1. Check all of the engine intake air ducting and make sure:
 - It is connected securely and correctly at the throttle body and all other connections. See Figures 1 and 2 on the next page.
 - All clamps and connectors are secure and tight.
 - There are no air leaks.
2. Perform DTC confirmation procedure to confirm the incident.
 - Refer to the Electronic Service Manual (ESM) for DTC confirmation procedures.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

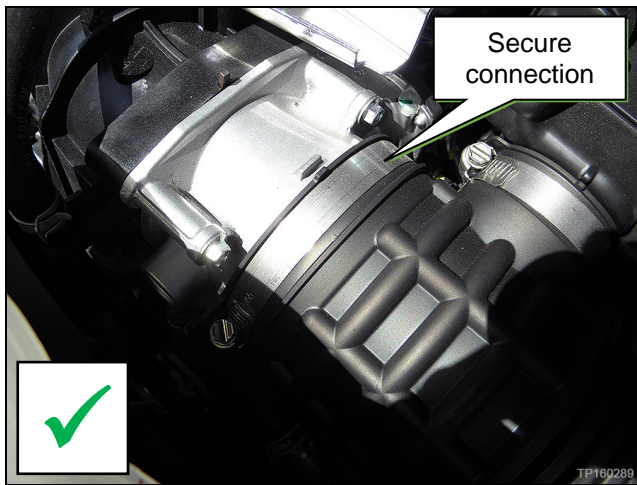


Figure 1

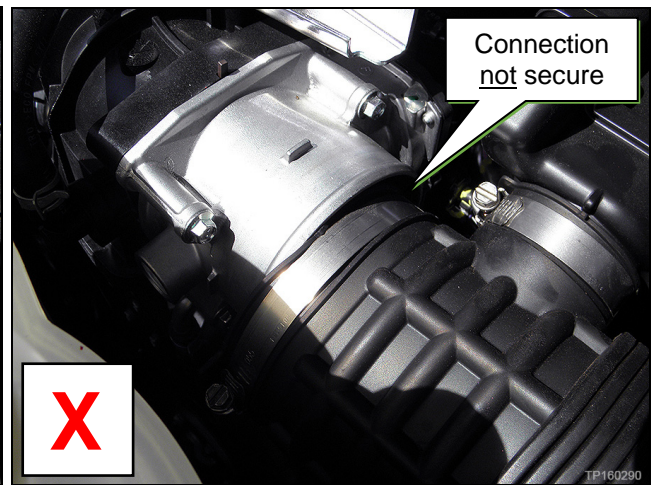


Figure 2

