

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [Elsa Newsletter](#) section in the Technician References menu.

Audi
Truth in Engineering



Audi Elsa Newsletter

Edition 179: March 28, 2016

Content


- [Reminder: ODIS Server License Expiration](#)
- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



Reminder: ODIS Server License Expiration

Please be reminded that ODIS Service licenses expire two years after download and installation.

When the License Expiration message and renewal prompt appear, please **DO NOT** select the YES prompt. (Select NO or x-out the window.)

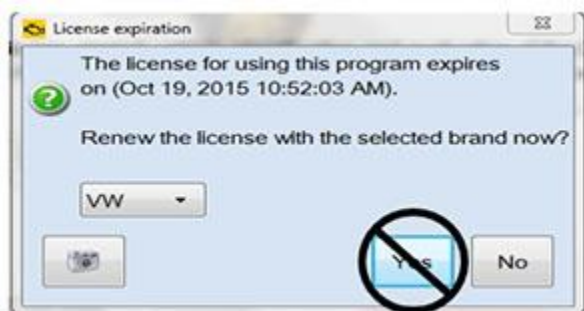

To request and install a new license, please refer to **Service Information – ODIS Service** document **AOS-15-15 License Renewal Instructions**.

Technical Bulletins

01 MIL on (DTC P0491/P0492 secondary air system bank 1/2 through-flow too low/malfunction) (2035002/4)		
Model(s)	Year	Vehicle Specific Equipment
A8	2010–2012	4.2FSI
Condition: • MIL on. • The following DTCs are stored in the engine control module, J623 (address word 01): ○ DTC P0491 (secondary air system bank 1, low flow) ○ DTC P0492 (secondary air system bank 2, low flow) Production Solution: Improved combination valves.		

[Back to top](#)

94 Headlight switch is loose or falls into dashboard (2024896/2)

Model(s)	Year	Vehicle Specific Equipment
Q7	2007–2015	Not Applicable
Condition: The headlight switch holder is broken, which causes the headlight switch assembly to be loose or fall into the dashboard. Production Solution: Not applicable.		

57 Emergency spare key missing at delivery (2041396/2)

Model(s)	Year	Vehicle Specific Equipment
A4, Q7, TT	2016–2018	Not Applicable
Condition: The plastic emergency spare key was not delivered with the vehicle. Production Solution: Not applicable.		

91 How to update MMI MIB navigation map - potential customer concerns (2037809/2)

Model(s)	Year	Vehicle Specific Equipment
A3	2015–2018	With navigation
A6, A7, TT	2016–2018	With navigation
A4, Q7	2017–2018	With navigation
Condition: The customer complains of one of the following concerns: • The navigation map does not show the latest roads or points of interest. • The map download provided by the myAudi web site (my.audiusa.com) cannot be performed. • The customer does not know how to obtain the data or cannot perform the update after downloading the data. • The MMI is slow to respond or freezes during the map update. • For vehicles with MIB2, the MMI over-the-air (OTA) map update does not allow for a full map update and shows greyed-out regions. • The customer is concerned that the OTA map update will consume too much data from the Audi connect data subscription. Production Solution: Not applicable.		

**48 Creaking or squeaking noises from steering column (sealing boot)
(2034351/6)**

Model(s)	Year	Vehicle Specific Equipment
A4, Q5	2009–2015	Not Applicable
A5	2008–2015	Not Applicable
A5 Cabriolet	2010–2015	Not Applicable
A6, A7	2012–2014	Not Applicable
Condition: Customer may report hearing creaking or squeaking noise from the steering column when steering slowly (the noise can be duplicated while the vehicle is stationary if the steering wheel is turned slowly). The noise may get louder at higher temperatures or when the vehicle is driven for a longer period of time. Production Solution: Not applicable.		

17 MIL on; whistling noises from engine compartment (DTC P2279 and/or P0507) (2040644/5)

Model(s)	Year	Vehicle Specific Equipment
A6, A7, A8	2013–2016	4.0 TFSI
Condition: - A metallic whistling or grinding sound is heard from the engine compartment when the vehicle is at idle speed. - The sound usually only occurs when the engine is warm. - The MIL is sporadically on. - The following DTCs are stored in the engine control module (ECM), J623 (address word 01): - DTC P2279 (Intake air system leak) - DTC P0507 (Idle control system RPM higher than expected) Production Solution: Fabric reinforced internal membrane of crankcase breather module.		

[Back to top](#)

46 Squeal from front brakes (2042182/1)		
Model(s)	Year	Vehicle Specific Equipment
Q5	2013–2017	2.0TFSI, 3.0TFSI, 3.0TDI
Condition: Customer reports hearing a squeal noise from the front brakes. Production Solution: Not applicable.		

46 Squeal from front brakes (2043706/1)		
Model(s)	Year	Vehicle Specific Equipment
Q5	2013	2.0TFSI, 3.0TFSI
Condition: Customer reports hearing a squeal noise from the front brakes. Production Solution: Not applicable.		

Pending Service Solutions

No new Pending Service Solutions this week.

Campaigns

No new campaigns this week.

Updates

No new updates this week.

Suggestions

Please send comments or suggestions to: aoa.workshopinformation@audi.com

[Back to top](#)

© 2016 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.