



Technical Bulletin

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf, Golf GTI	2015 - 2016	All	All	All	All

Condition

60 16 03 February 25, 2016 **2043031** Supersedes Technical Bulletin V601602 dated February 5, 2016 to update damage code in warranty table.

Rattle or Creaking Noise from Panoramic Sunroof

A rattle or creaking noise may be heard from the rear of the Panoramic Sunroof when driving on uneven roads with the sunroof closed.

Technical Background

Rattle or creaking noise is caused by the relative movement between the glass panel seal and body when the sunroof is closed.

Production Solution

Not applicable.



Technical Bulletin

Service

Apply self-adhesive protective film to vehicle body:

- Cut the protective film sheet (part number AKL 448 300 04) into 3 strips 12 mm wide x 290 mm (290 mm is the length of the long side of the protective film sheet).
- Move the glass panel to the tilt open position.
- Thoroughly clean the contact area between the rear glass panel seal and the body.
- Apply the self-adhesive protective film strip to the body (Figure 1, in red).
- Close the glass panel.

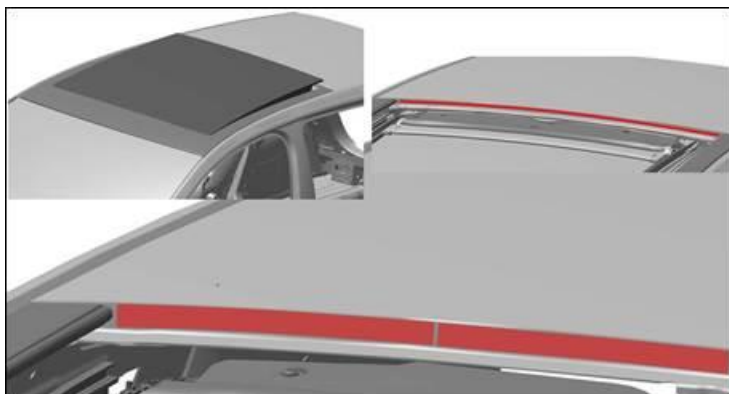


Figure 1) Area to apply the self-adhesive film (glass panel removed for illustration purposes).



Technical Bulletin

Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual ¹⁾					
Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
Golf, Golf GTI	2015 - 2016	All	All	All	All
SAGA Coding					
Claim Type:	Use applicable Claim Type ¹⁾				
Service Number:	Damage Code	HST		Damage Location (Depends on Service No.)	
6042	0010	--		Use applicable when indicated in Elsa (L/R)	
Parts Manufacturer	Golf, Golf GTI			3ME ²⁾	
Labor Operation ³⁾ : Install self-adhesive protective film			60422399 = 30 TU		
Causal Part: Select Labor Operation			60422399		
Diagnostic Time ⁴⁾					
GFF Time expenditure	01500000 = 00 TU max.			NO	
Road Test	01210002 = 10 TU max. 01210004 = 10 TU max.			YES	
Technical Diagnosis	01320000 = 00 TU max.			NO	
Claim Comment: Input "As per Technical Bulletin 2043031" in comment section of Warranty claim.					
¹⁾ Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only ²⁾ Code per warranty vendor code policy. ³⁾ Labor Time Units (TUs) are subject to change with ELSA updates. ⁴⁾ Documentation required per Warranty Policies and Procedures Manual.					



Technical Bulletin

Required Parts and Tools

Part No:	Part Description	Quantity
AKL 448 300 04	Protective film	1

No Special Tools required.

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.