

In the Event of a Customer Complaint About Door Cover Sticking Up or Loose: Replacing all four door covers (84/16)

Vehicle Type: **Macan**

Model Year: **As of 2014 up to 2016**

Subject: **Cover for front and rear doors**

Information: **There is a possibility that covers on front and rear doors can become loose and start to stick up due to adhesion problems.**


Remedial Action: In the event of a customer complaint, **all four covers** on front and rear doors **must be replaced**.

Parts Info:

Part No.:		I-no.	Number:
95B.898.561 - OK1	⇒ Cover for front left door - Black Mat	6H0	1 ea.
95B.898.562 - OK1	⇒ Cover for front right door - Black Mat	6H0	1 ea.
95B.898.565 - OK1	⇒ Cover for rear left door - Black Mat	6H0	1 ea.
95B.898.566 - OK1	⇒ Cover for rear right door - Black Mat	6H0	1 ea.
95B.898.561.A	⇒ Cover for front left door - prime-coated	6H1 6H5 6H6	1 ea.
	+ for I-no. E0W/6H6, also order the following:		
95B.800.951	⇒ Decorative film, Gloss Black - GTS or	E0W/6H6	1 ea.
95B.800.951.A	⇒ Decorative film, Black Mat/Satin Black - GTS		1 ea.
95B.898.562.A	⇒ Cover for front right door - prime-coated	6H1 6H5 6H6	1 ea.
	+ for I-no. E0W/6H6, also order the following:		
95B.800.951	⇒ Decorative film, Gloss Black - GTS or	E0W/6H6	1 ea.
95B.800.951.A	⇒ Decorative film, Black Mat/Satin Black - GTS		1 ea.


95B.898.565.A	⇒ Cover for rear left door - prime-coated	6H1 6H5 6H6	1 ea.
95B.898.566.A	⇒ Cover for rear right door - prime-coated	6H1 6H5 6H6	1 ea.
95B.898.563	⇒ Cover for front left door - carbon-fibre composite	6H3	1 ea.
95B.837.901.BY	⇒ Cover for front left door - carbon-fibre composite (with GTS logo)	EOW	
95B.898.564	⇒ Cover for front right door - carbon-fibre composite	6H3	1 ea.
95B.837.902.BY	⇒ Cover for front right door - carbon-fibre composite (with GTS logo)	EOW	
95B.898.567	⇒ Cover for rear left door - carbon-fibre composite	6H3	1 ea.
95B.898.568	⇒ Cover for rear right door - carbon-fibre composite	6H3	1 ea.

Work Procedure: 1 Remove cover for front door ⇒ *Removing cover for front door -1-* at the left and right. ⇒ *Workshop Manual '662219 Removing and installing cover for front door'*

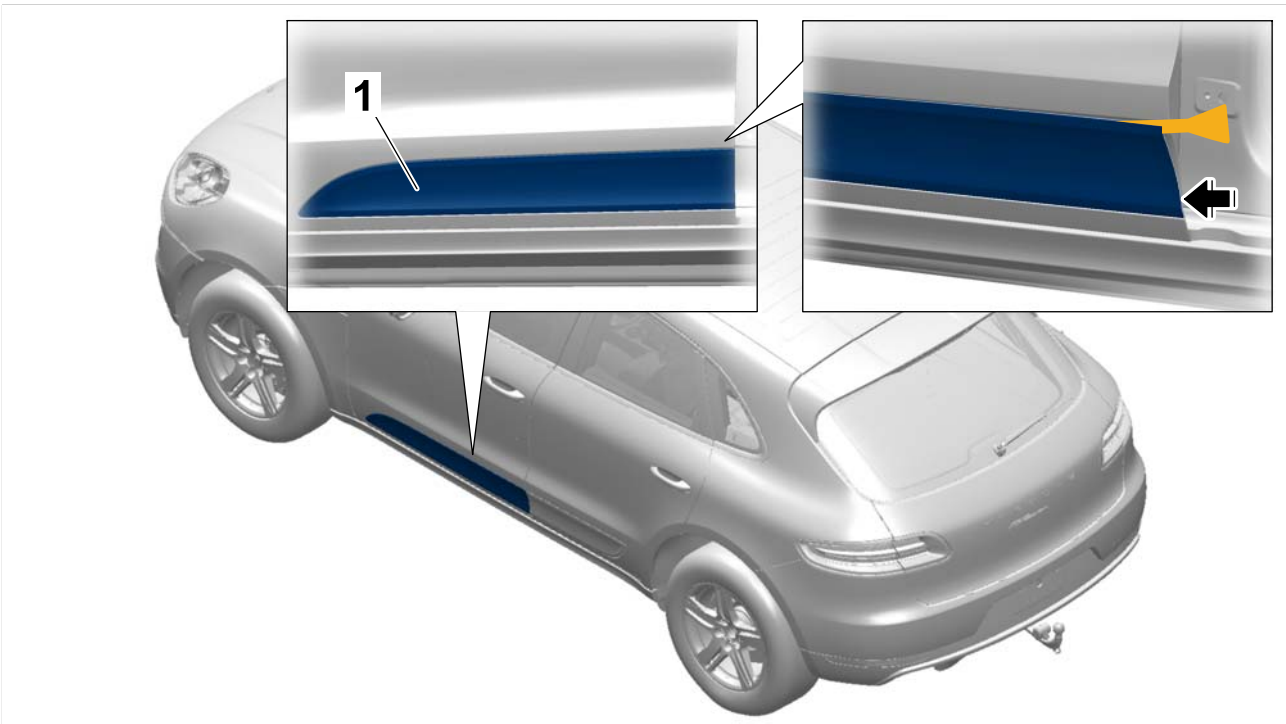

Removing cover for front door

- 2 Remove cover for rear door ⇒ *Removing cover for rear door -1-* at the left and right. ⇒ *Workshop Manual '664219 Removing and installing cover for rear door'*

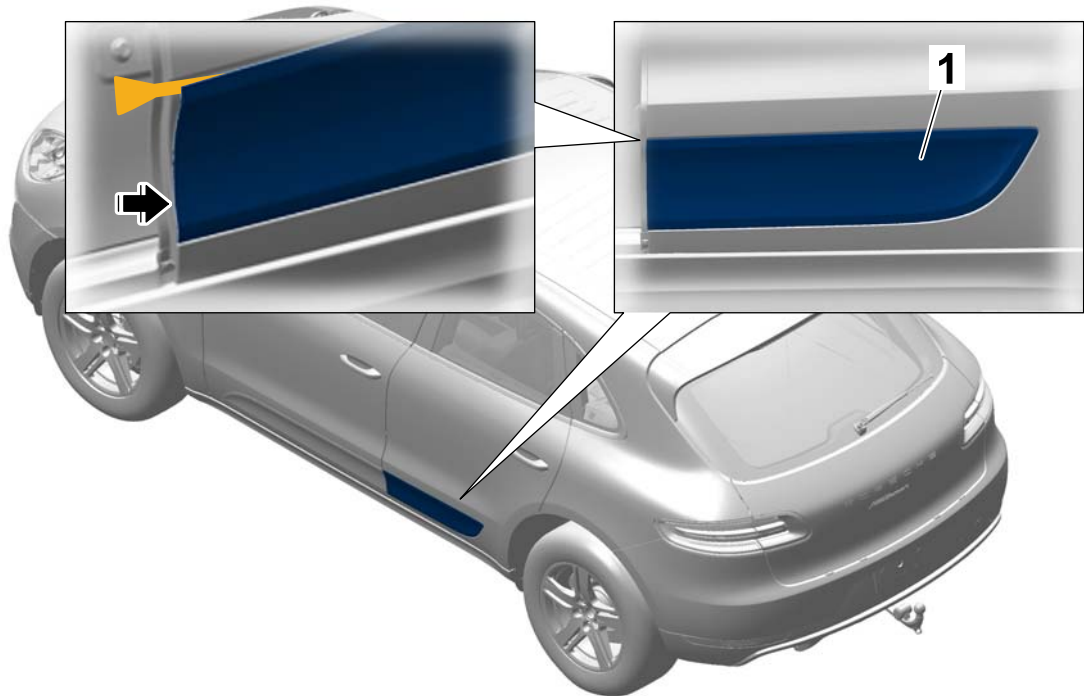

Removing cover for rear door

- 3 **Only for door cover in vehicle colour (I-no. 6H1, 6H5 or 6H6):**
Paint new covers for front and rear doors at the left and right in vehicle colour.
- 4 **Install new** covers for rear doors at the left and right. ⇒ *Workshop Manual '664219 Removing and installing cover for rear door'*
- 5 **Install new** covers for front doors at the left and right. ⇒ *Workshop Manual '662219 Removing and installing cover for front door'*

Invoicing: For documentation using PQIS, enter the following coding:

Location (FES5)	66220	Cover for front door
Damage type (SA4)	1051	Bonding defective

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. If a particular condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your authorized Porsche Dealer for the latest information about whether a particular technical bulletin applies to your vehicle. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify the current and correct part numbers. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© Porsche Cars North America, Inc.

Dealership	Service Manager	Shop Foreman	Service Technician
Distribution	Asst. Manager	Warranty Admin.	Service Technician
Routing			

Dr. Ing. h.c. F. Porsche AG is the owner of numerous trademarks, both registered and unregistered, including without limitation the Porsche Crest®, Porsche®, Boxster®, Carrera®, Cayenne®, Cayman®, Macan®, Panamera®, Speedster®, Spyder®, 918 Spyder®, Tiptronic®, VarioCam®, PCM®, PDK®, 911®, RS®, 4S®, FOUR, UNCOMPROMISED®, and the model numbers and the distinctive shapes of the Porsche automobiles such as, the federally registered 911 and Boxster automobiles. The third party trademarks contained herein are the properties of their respective owners. Porsche Cars North America, Inc. believes the specifications to be correct at the time of printing. Specifications, performance standards, standard equipment, options, and other elements shown are subject to change without notice. Some options may be unavailable when a car is built. Some vehicles may be shown with non-U.S. equipment. The information contained herein is for internal authorized Porsche dealer use only and cannot be copied or distributed. Porsche recommends seat belt usage and observance of traffic laws at all times.

Printed in the USA