



TECHNICAL SERVICE BULLETIN

TSB#: **16-001** Job Code: **9801276** Flat Rate: .5 hr
Date of Publication: **January 2016**

**NOTE: This Technical Service Bulletin will be valid within (1) year from the original date of publication.
NO PARTS ARE REQUIRED**

ACTION REQUIRED:

Inspect bolts on the 78" bed slide at the front off door side for proper tension setting.
Adjust the bolts for proper tension when required

MODELS / UNITS:

2016 Jay Flight Bungalow	40DBTS	G1	1G0066
	40BHQS	G1	1H0087,90,93-94,97-101
	40RLTS	G1	1J0121-125,127-137, 139,142-143,146-147
	40FKDS	G1	1K0090-92,95,98-106,108-110

TOOLS/MATERIAL REQ.:

Ratchet wrench
3/4" deep well socket
Tape measure

INSTRUCTIONS



FIG 1

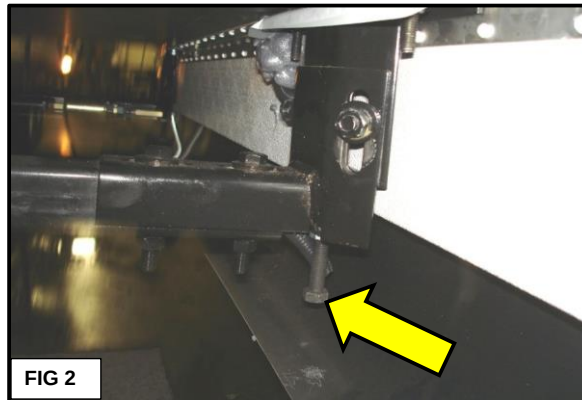


FIG 2

- Fig 1:** Run the 78" bed slide about 1/2 way out so you can get underneath to inspect the slide mechanism.
Fig 2: Inspect the lower bolts (one at each end of slideout)

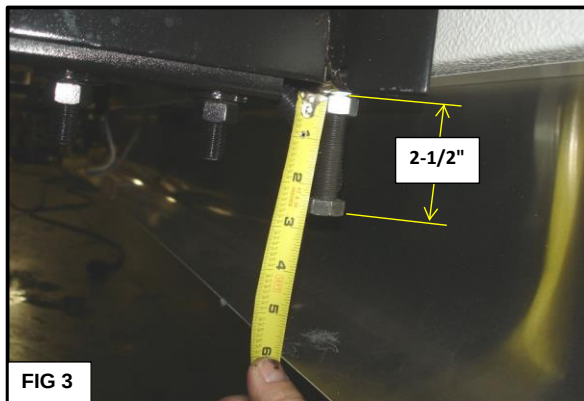


FIG 3





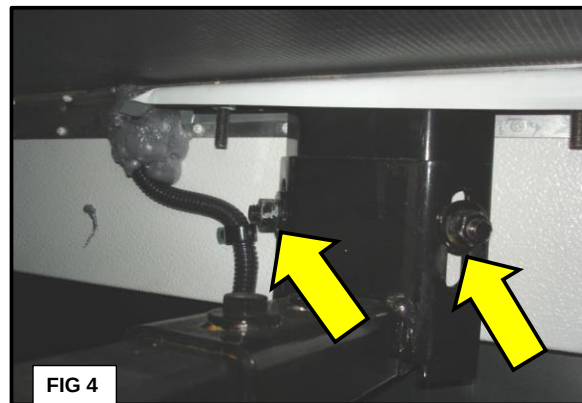


FIG 4

- Fig 3:** Measure the length of the bolt from the slideout nut as shown here. **If the length of the bolt measured from the top of the nut down to the head of the bolt is NOT at 2" then the slideout requires adjusting.**
Measure the bolt on the other end of the slideout as well.
Fig 4: To begin the adjustment procedure, use the ratchet and 3/4" socket to loosen the two nuts shown.

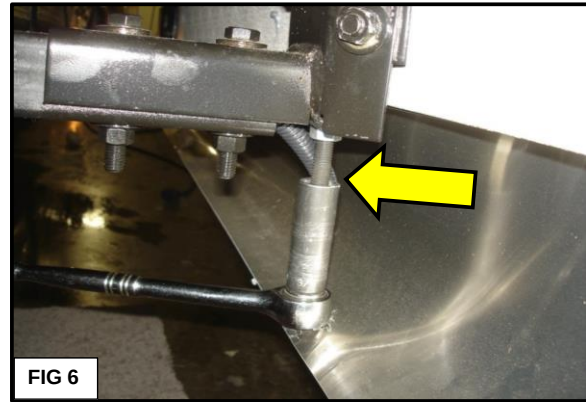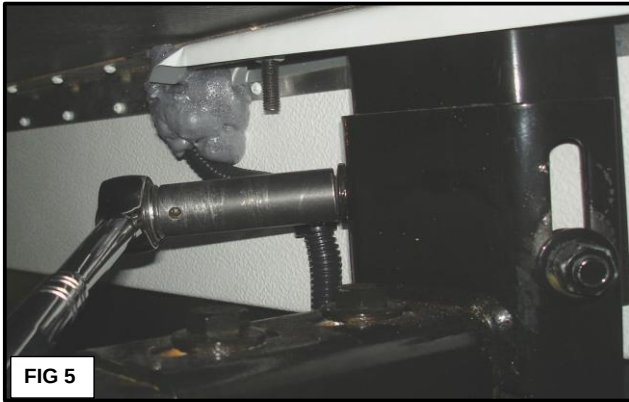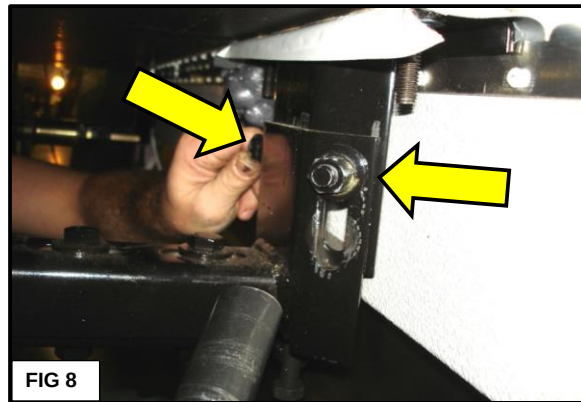

- 3 **Fig 5:** Loosen the nuts just enough to slide in the channels.
Fig 6: Use the ratchet and socket to tighten the lower bolt until it is at 2".

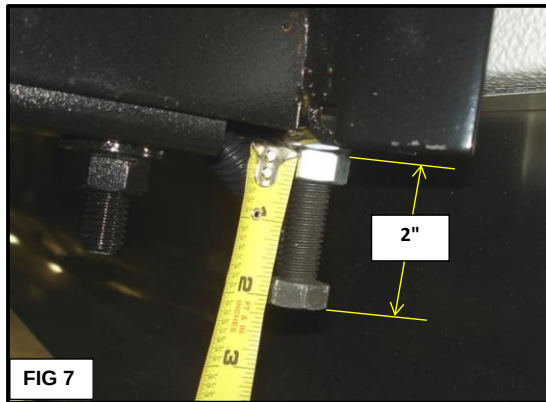

- 4 **Fig 7:** Bolt should be adjusted until it measures 2 inches from the top of the nut to the head of the bolt as shown.
Fig 8: Make sure the two 3/4" nuts in the slots are all the way to the top of the slots as shown.
Tighten the nuts - adjustment is complete for one side.
- 5 Repeat the steps for the adjustment on the other end of the slideout.