



TECHNICAL SERVICE BULLETIN

TSB#: 16-002

Job Code: 9801278

Flat Rate: 0.5

Date of Publication:

February 2016

NOTE: This Technical Service Bulletin will be valid within (1) year from the original date of publication. REQUIRES PARTS TO BE ORDERED FROM JAYCO.

ACTION REQUIRED:

Correct wiring to the generator start switch in command center.


MODELS / UNITS:

| | | | |
|---------------------------|------|------|---------|
| 2016 Designer Fifth Wheel | 37RS | G1S1 | 0053-55 |
| | 39FL | G1S2 | 0052-54 |
| | 37RE | G1S4 | 0052-55 |

PARTS KIT CONTENTS:

Note: Parts Kit can only be ordered using the order form included with this bulletin.

- 1 14ga black jumper wire 12" long
- 1 Scotchlok connector

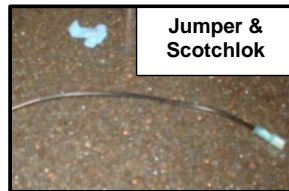

TOOLS/MATERIAL REQ.:

- Pliers
- Screw gun with #2 square drive bit
- black electrical tape

INSTRUCTIONS

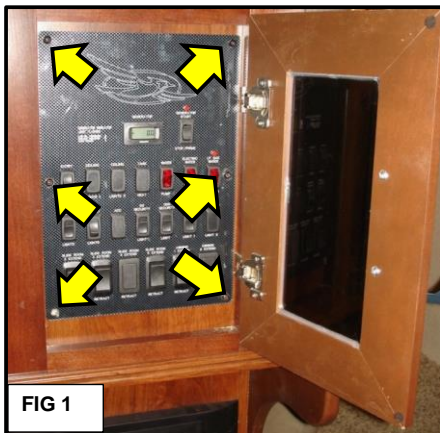


FIG 1



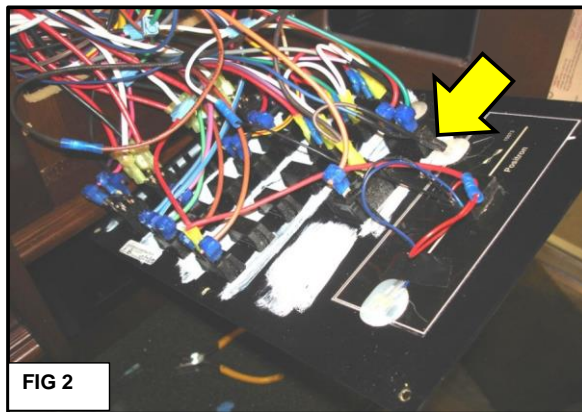




FIG 2

1 Fig 1: Remove 6 screws on the Command Center panel.



Fig 2: Pull the panel out and look at the backside. Locate the **GENERATOR START** switch with double brown wires.

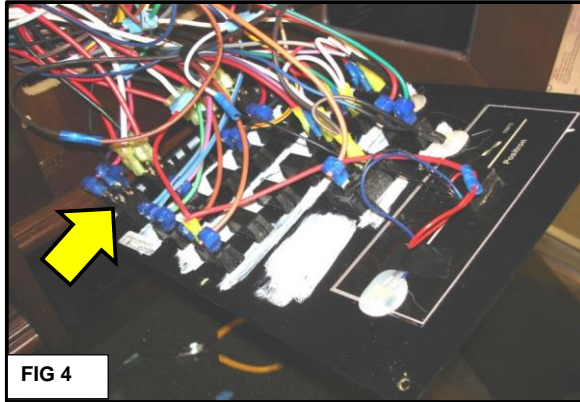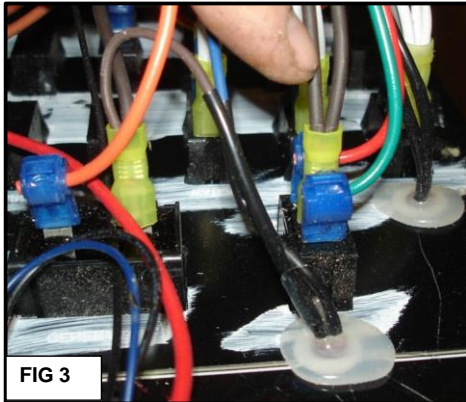

- 2 **Fig 3:** **GENERATOR START** switch shown with double brown wires.
 Pull the connector with the brown wires off the switch and wrap it with electrical tape so it won't short out to anything.
Fig 4: Locate the **SLIDE 2 EXTEND** switch on the opposite end of the panel in opposite corner.

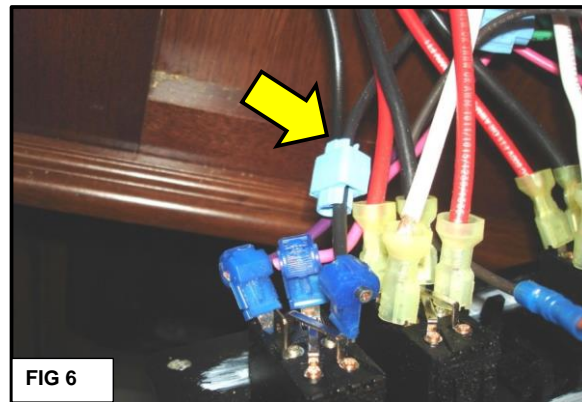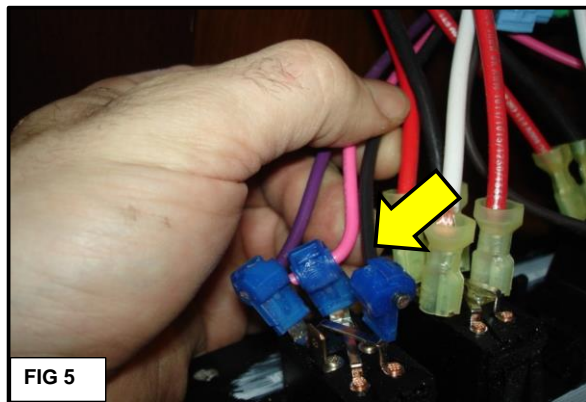

- 3 **Fig 5:** The **SLIDE 2 EXTEND** switch will have a black, pink and purple wire attached to it as shown.
Fig 6: Put the Scotchlok connector on the black wire of the **SLIDE 2 EXTEND** as shown. (this is the B+ wire powering the switch)
 Insert the plain end of the new 14ga black jumper wire into the Scotchlok connector, and crimp the connector with pliers.

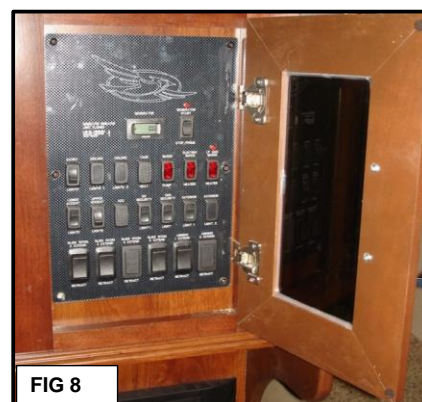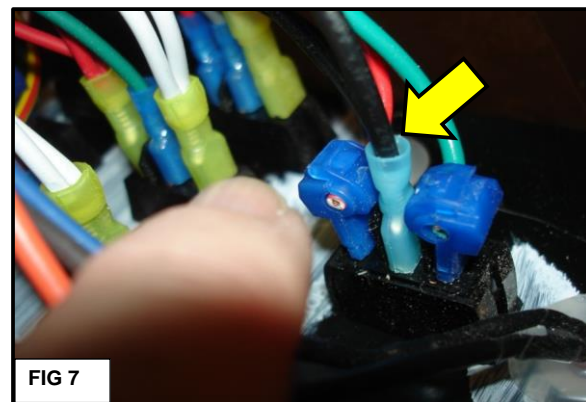

- 4 **Fig 7:** Attach the other end of the new 14ga black jumper wire to the **GENERATOR START** switch center terminal.
Fig 8: Re-attach the Command Center panel with the 6 screws removed previously.
 5 Test the generator (or the generator prep start/stop relay pack) for start and stop functionality.



February 2016

Technical Service Bulletin Notification TSB #16-002

Name
Address
City state zip
country

Dear Valued Jayco RV Dealer:

Jayco has determined certain Model Year 2016 Designer fifth wheels equipped with the Generator prep option; require corrective wiring to the switch at the command center.

Our records indicate that the following unit is currently stock at your dealership and affected by this Service Bulletin and requires the repair prior to retail sale:

The coverage period for this Technical Service Bulletin is for one (1) year from the release of this notification. (February 2016- February 2017). If you have sold this affected vehicle, please contact the current owner regarding this Service Bulletin and process the Warranty Registration for this customer. All pertinent information regarding this Bulletin is on file under the Service and Parts Tab of Jayco Partners. If you have questions regarding this Service Bulletin, please contact Jayco Customer Service at 800-283-8267.

We apologize for any inconvenience this may cause. However, we are confident that this improvement will offer continued satisfaction with your Jayco products.

Sincerely,
Jayco