

Service Update

35740 Thermal Sleeve Missing From Lamp Wire Harness Connector



Reference Number: N16204566
GWM Number:

Release Date: December 2016
Revision: 00

Attention: This service update includes vehicles in dealer inventory and customer vehicles that return to the dealership for any reason. This bulletin will expire at the end of the involved vehicle's New Vehicle Limited Warranty period.

Make	Model	Model Year		RPO	Description
		From	To		
Chevrolet	Camaro	2016	2016	LTG	2.0L Turbo Engine

Involved vehicles are marked "open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

Condition	Some vehicles were built without a thermal sleeve on the main body wire harness to forward lamp wire harness connector.
Correction	Dealers will cover the forward lamp wire harness and connector with a heat resistant thermal wrap.

Parts

Quantity	Part Name	Part No.
1	Thermal Wrap	84236003

Warranty Information

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9102774	Install Thermal Wrap	0.2	ZFAT	*

Service Procedure

1. Open hood and install fender covers.



4578904

2. Locate the main body wiring harness to forward lamp wiring harness connector (1).
3. Using an appropriate retainer removal tool, disengage the connector retainer from the body.

Service Update

35740 Thermal Sleeve Missing From Lamp Wire Harness Connector



4578905

4. Install the thermal wrap on the main body wiring harness to forward lamp wiring harness connector (1).
5. Engage the connector retainer into the body.
6. Remove fender covers and close hood.

Dealer Responsibility

Whenever a vehicle subject to this service update enters your vehicle inventory, or is in your facility for service in the future, and the vehicle is still covered under the New Vehicle Limited Warranty, you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this bulletin must be held and inspected/repared per the service procedure of this bulletin before customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.



GLOBAL SAFETY FIELD INVESTIGATIONS
DCS4274
URGENT - DISTRIBUTE IMMEDIATELY

Date: December 1, 2016

Subject: 35740 - Service Update
Thermal Sleeve Missing From Lamp Wire Harness Connector

Models: 2016 Chevrolet Camaro Equipped with 2.0L Turbo Engine (LTG)

To: All General Motors Dealers

General Motors is releasing Service Update today. The total number of U.S. vehicles involved is approximately 244. Please see the attached bulletin for details.

Global Warranty Management (GWM)

The Investigate Vehicle History (IVH) screen in the GWM system will be updated December 2, 2016. A list of involved vehicles in dealer new inventory is attached to this message. Please hold all warranty transactions until the VIN appears in IVH.

END OF MESSAGE
GLOBAL SAFETY FIELD INVESTIGATIONS