

# Service Update

## 49070 Lane Keep Assist Unavailable



**Reference Number:** N162049070  
**GWM Number:** 2049070

**Release Date:** August 2016  
**Revision:** 00

**Attention:** This service update includes vehicles in dealer inventory and customer vehicles that return to the dealership for any reason. This bulletin will expire at the end of the involved vehicle's New Vehicle Limited Warranty period.

Make	Model	Model Year		RPO	Description
		From	To		
Cadillac	CTS	2016	2016		

Involved vehicles are marked "open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

<b>Condition</b>	On certain 2016 model year Cadillac CTS vehicles, after the ignition is cycled to "ON", and during bulb check, the Lane Keep Assist (LKA) feature may set a short to ground fault and become unavailable for an ignition cycle. The failure is only noticeable to the driver when the feature does not function and the driver presses the switch. Upon doing so, "Lane Keeping Assist Unavailable" will be displayed in the driver information center.
<b>Correction</b>	Dealers are to reprogram the front camera module with new software.

### Parts

No parts are required for this procedure.

### Warranty Information

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9102459	Front View Camera Reprogramming with SPS	0.3	ZFAT	N/A

### Service Procedure

**Note:** Carefully read and follow the instructions below.

- Do NOT attempt to order the calibration number from GM Customer Care and Aftersales. The calibration numbers required for this service procedure are programmed into control modules via a Multiple Diagnostic Interface (MDI) with the calibration update.
- Do NOT program a control module unless directed to by a service procedure or a service bulletin. If the control module is not properly configured with the correct calibration software, the control module will not control all of the vehicle features properly.
- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.
- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. When required, install the *EL-49642* SPS Programming Support Tool to maintain system voltage. If not available, connect a fully charged 12 V jumper or booster pack disconnected from the AC voltage supply. DO NOT connect a battery charger.
- Turn OFF or disable systems that may put a load on the vehicles battery such as; interior lights, exterior lights (including daytime running lights), HVAC, radio, etc.
- During the programming procedure, follow the SPS prompts for the correct ignition switch position.
- Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.
- Prior to programming, record the engine oil life percentage remaining.

Reprogram the front view camera module. Refer to *Front View Camera Module Programming and Setup* In SI.

# Service Update

## 49070 Lane Keep Assist Unavailable



### Dealer Responsibility

Whenever a vehicle subject to this service update enters your vehicle inventory, or is in your facility for service in the future, and the vehicle is still covered under the New Vehicle Limited Warranty, you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this bulletin must be held and inspected/repaired per the service procedure of this bulletin before customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.

---

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the tools, equipment, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your dealer for information on whether your vehicle may benefit from the information.



**We Support  
Voluntary Technician  
Certification**

GLOBAL SAFETY FIELD INVESTIGATIONS  
DCS4128  
URGENT - DISTRIBUTE IMMEDIATELY

Date: August 1, 2016

Subject: 49070 - Service Update  
Lane Keep Assist Unavailable

Models: 2016 Cadillac CTS

To: All Cadillac Dealers

General Motors is releasing Service Update 49070 today. The total number of U.S. vehicles involved is approximately 28. Please see the attached bulletin for details.

**Global Warranty Management (GWM)**

The Investigate Vehicle History (IVH) screen in the GWM system will be updated August 2, 2016. A list of involved vehicles in dealer new inventory is attached to this message. Please hold all warranty transactions until the VIN appears in IVH.

END OF MESSAGE

GLOBAL SAFETY FIELD INVESTIGATIONS