

Service Update

16089 Thin Wall Near Fuel Tank Attachment Tab



Reference Number: N16207249

Release Date: November 2016

Revision: 00

Attention: This service update includes vehicles in dealer inventory and customer vehicles that return to the dealership for any reason. This bulletin will expire at the end of the involved vehicle's New Vehicle Limited Warranty period.

Make	Model	Model Year		RPO	Description
		From	To		
Chevrolet	Camaro	2017	2017		

Involved vehicles are marked "open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

Condition	A bubble may have formed during the molding process of the fuel tank, which results in a thin wall condition near an attachment tab. The thin wall area of the tank may result in a fuel leak resulting in a fuel odor, or fuel loss to the ground and/or a check engine light being illuminated.
Correction	Dealers are to replace the fuel tank.

Parts

Quantity	Part Name	Part No.
1	Fuel Tank	23421807
1	Clamp - Catalytic Conv	22860193
1	Gasket - Catalytic Conv	22759470
1	Gasket - Catalytic Conv	21992620
2	Bolt - Rear Suspension Cradle, Front	11547921
2	Seal -Fuel Pump (O-Ring)	22682111
1 (If Required)	Cam – Fuel Sender	22738433
1 (If Required)	Ring – Fuel Sender	10325852

Note: Use the VIN and the GM Electronic Parts Catalog (EPC) to determine which fasteners and gaskets to order.

Due to the small number of vehicles involved (12) dealers should not order parts for use as shelf stock. Parts should only be ordered when inspection determines that it is necessary.

Warranty Information

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9102727	Fuel Tank Replacement - 2.0L and 3.6L - 6.2L ADD: Drain and Fill Fuel	2.8 3.3 0.4	ZFAT	N/A

Service Procedure

1. Replace the fuel tank. Refer to *Fuel Tank Replacement* in SI.

Dealer Responsibility

Whenever a vehicle subject to this service update enters your vehicle inventory, or is in your facility for service in the future, and the vehicle is still covered under the New Vehicle Limited Warranty, you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this bulletin must be held and inspected/repaired per the service procedure of this bulletin before customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting

Service Update

16089 Thin Wall Near Fuel Tank Attachment Tab



an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the tools, equipment, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your dealer for information on whether your vehicle may benefit from the information.



**We Support
Voluntary Technician
Certification**

GLOBAL SAFETY FIELD INVESTIGATIONS
DCS4266
URGENT - DISTRIBUTE IMMEDIATELY

Date: November 21, 2016
Subject: 16089 - Service Update
Thin Wall Near Fuel Tank Attachment Tab
Models: 2017 Chevrolet Camaro
To: All General Motors Dealers

General Motors is releasing Service Update 16089 today. The total number of U.S. vehicles involved is 12. Please see the attached bulletin for details.

Global Warranty Management (GWM)

The Investigate Vehicle History (IVH) screen in the GWM system will be updated November 21, 2016. A list of involved vehicles in dealer new inventory is attached to this message. Please hold all warranty transactions until the VIN appears in IVH.

END OF MESSAGE
GLOBAL SAFETY FIELD INVESTIGATIONS