

Model(s)	Year(s)	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta	2017	All	All	AJ_HM200001	AJ_HM258458

Condition

70 16 01 October 25, 2016 2045671

Car-Net Module Housing Loose at PDI

The Car-Net module housing may be loose underneath the passenger seat. This may be found during PDI or from a customer complaint.

Technical Background

Cut-outs in the carpet may not have been removed in the factory which prevents the Car-Net module housing from being properly installed.

Production Solution

Production is removing the cut-out holes from the carpet to guarantee the correct fixation of the Car-Net module housing as of VIN AJ_HM258458.



Service

Procedure:

During PDI inspect the Car-Net module housing which is mounted underneath the passenger front seat (Figure 1).



Figure 1: Car-Net module housing loose



If the module housing is loose, not flat against the floor, or is rubbing the seat fore/aft adjustment lever, check that the pre-perforated cut-outs have been removed from the carpet (Figure 2).

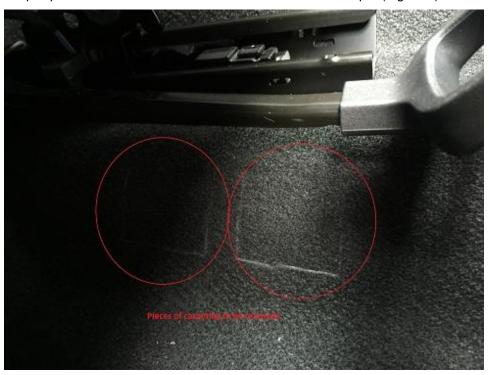


Figure 2: Pre-perforated carpet cut-outs not removed

Remove the carpet cut-outs if they haven't already been removed and reinstall the module housing by first inserting the tabs on the housing through the cut-outs in the carpet, then pressing the housing down onto the carpet to secure the Velcro fastener (Figures 3 and 4).



Figures 3 and 4: Carpet cut-outs removed and locking tabs on housing



If the cut-outs have already been removed, ensure the housing is reinstalled properly (Figure 5).



Figure 5: Car-Net module housing properly installed.



Warranty

Model(s)	Yea	ır(s)	Eng. Code(s)	Trans. Code(s)	AJ_HM200001		VIN Range To	
Jetta	20	17	All	All			AJ_HM258458	
SAGA Coding								
Claim Type: Use applicable Claim Type 1)								
Service Number:		Damage Code	HST		Damage Location (Depends on Service No.)			
7041		0010			Use applicable when indicated in Elsa (L/R)			
Parts Manufacturer			Je	Jetta		3ME ²⁾		
Labor Operation 3):				70413399 = 10 TU				
Remove and install Car-Net Module Housing								
Causal Part: Select Labor Operation				70412399				
			Diagnost	tic Time ⁴⁾				
GFF Time expenditure			01500000 = 00 TU max.		NO			
Road Test			01210002 = 00 TU 01210004 = 00 TU		NO			
Technical Diagnosis			01320000 = 00 TU max.		NO			

Claim Comment: Input "As per Technical Bulletin 2045671" in comment section of Warranty Claim.

¹⁾ Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only

²⁾ Code per warranty vendor code policy.

³⁾ Labor Time Units (TUs) are subject to change with ELSA updates.

⁴⁾ Documentation required per Warranty Policies and Procedures Manual.



Required Parts and Tools

No Special Parts required.

No Special Tools required.

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

Document Control Revision Table								
Instance Number	Published Date	Version Number	Reason For Update					
2045671/1	10/25/16	V701601	Original Publication.					