



Technical Service Bulletin

01 MIL on, DTC P060C00 stored in ECM

01 16 83 2045673/1 October 21, 2016.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7	2016	All	3.0 TFSI

Condition

MIL on and the DTC below is stored in the engine control module (ECM), J623 (address word 01):

- **DTC P060C00** (Internal Control Module Main Processor Performance)

Technical Background

Not applicable.

Production Solution

Optimized software with improved diagnostics.

Service

Do not replace any parts for these fault codes unless directed to do so by GFF. Do not contact Technical Assistance Center (TAC) unless the problem persists after the software update or if there is a problem with the SVM process.

1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
2. Update the engine control module using the SVM action code as listed in the table below if necessary:

Model	Engine and/or Transmission	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Action Code
-------	----------------------------	--------------------------	----------------------	--------------------------	----------------------------------	-----------------



Technical Service Bulletin

C7 A6/A7	CREC	4G2907551A	≤ 0004	4G2907551C	0001	01A226
-------------	------	------------	--------	------------	------	--------

3. If fault code still remains after software flash, work through the appropriate GFF test instructions (not covered under this TSB).

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • 1E1 up to 8 Years/80,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If vehicle is outside any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	2470		
Damage Code:	0039		
Labor Operations:	Connect battery charger and perform software update with SVM	2470 2599	50 TU
Diagnostic Time:	GFF	0150 0000	20 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2045673/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Additional Information

All parts and service references provided in this TSB (2045673) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2016 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.