Tech Tips



Date: May 20, 2016

2015 Golf, GTI, Golf R, Sportwagen, eGolf – MIB1, 2016-2017 Golf, GTI, Golf R, Sportwagon, eGolf, Passat, Jetta, CC, Tiguan, Beetle, Beetle Convertible – MIB2- B201A Fault Stored in MIB2 Infotainment System

November 4, 2016: Update to Model Year Applicability.

After replacing or updating a J794/5F module, a "B201A: Checking software version management" fault may store. To erase this fault, perform the following:

Under the Special Functions tab, run the "005F-Design status check/reset DTC memory" test plan.

😒 Offboard Diagnostic Information System Service - 3.0.3								
Importer: Dealer: RO:	444 03100 	VIN: Engine:	3VWC17AU9GM511912 all engine identifier codes	🧀 🦺 🏷				
Control modu	ules Orders DISS TSB Test plan Ope	eration Special Functions			Operating modes *			
Tests for the	entire vehicle	1			🧐 Diagnosis			
Status	Tests				🕐 OBD			
-	0025 - Online system test				International In			
-	0025 - XCP Debug							
	0025 - Component protection functions				Measurement			
		-			😭 Info			
	0025 - Snowroom mode				Admin			
_	KS-Master (Gateway) connect	ion system						
	005F - Information electronics control r	module 1 J794			Log ×			
-	005F - Design status check/res	set DTC memory			Data ¥			
	Software version management				Duiu			
-	Adapt software (offline)				Extras ¥			
	, approximate (online)				Help ¥			
	Adapting software				Trop			
-	Code online control module	m		-	Info ×			
Perform tes	t Display documents				>> 🛛 🔇			
Windows Explorer Read control modules again								

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Service Information

When the test plan reaches the step to "restart the Main-Unit via the Touch-Screen-Monitor, hold the radio's power button down for 10 seconds to reboot the J794. Once the radio turns back on, select Complete/Continue.

🖏 Offboard Diagnostic	Information System Service - 3.0.3	120					
Importer:	444	VIN:	3VWC17AU9GM5119	912 🧀 🚚 🍗			
Dealer:	03100	Engine:	all engine identifier coo	des			
RU.					Operating modes		
	orders DISS TSB Test p	an Operation Special Functions			operating modes *		
Reset BZD/FSP Complete/Continue							
NOTE:					()) OBD		
- Please restart the Main-Unit via the Touch-Screen-Monitor.							
NOTE:							
 The "restart" of If no update h 	only appears on the touchso as been performed, no rest	reen monitor if the main unit was u art of the Main Unit is not necessa	updated via a data carrier in advance ry.	}.	lnfo		
					C Admin		
					- Log ¥		
					Data ¥		
					Extras ¥		
					Help ¥		
					Info ×		
			Unio Consult				
	15		Heip Cancel t	lest			
				Test version			

Once the test plan ends, the B201A fault should clear.

© 2016 Volkswagen Group of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.