

1 05 15-16



Service Information Bulletin

SUBJECT	DATE
Exhaust Gas Recirculation Valve	May 2015

Additions, Revisions, or Updates

Publication Number / Title	Platform	Section Title	Change
DDC-SVC-MAN-0190	DD Platform - GHG17	Inspection of the DD13 and DD15 Exhaust Gas Recirculation Valve Actuator	Procedure update - Coolant leak inspection at wiring harness connection.



13400 Outer Drive, West, Detroit, Michigan 48239-4001
 Telephone: 313-592-5000
www.demanddetroit.com

2 Inspection of the DD13 and DD15 Exhaust Gas Recirculation Valve

Inspect as follows:

1. Visually inspect the Exhaust Gas Recirculation (EGR) valve actuator for cracks or other damage. Replace if damaged.
2. Inspect EGR valve actuator wiring harness connector for coolant intrusion and/or corrosion. If found, replace the EGR valve actuator, replace the engine sensor harness and inspect the 120-pin connector at the MCM for signs of coolant intrusion and/or corrosion. Replace the MCM if coolant or corrosion is found.
3. Inspect the electrical wiring harness and connector for chafing and/or loose pins.