

Click Noise From Rear While Driving

Service Category Suspension

Section Rear Suspension

Market USA

Toyota Supports
 ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2016	Prius	

Introduction

Some 2016 model year Prius vehicles may exhibit a clicking noise from the support nuts on the rear shocks. The assembly process has been improved to prevent this from reoccurring. Follow the Repair Procedure below to address this condition.

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PRODUCTION CHANGE EFFECTIVE VIN
Prius	JTDKBRFU#G3006967
	JTDKARFU#G3007491

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
482201	R & R Shock – Top Nut	1.3	94130-61200	91	81
482201A	R & R Shock – Top Nut Comb: Opposite Side	0.2	94130-61200	91	81

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.



Click Noise From Rear While Driving

Parts Information

PART NUMBER	PART NAME	QTY
94130-61200	Nut (For Rear Support To Rear Shock Absorber)	2

Required Tools & Equipment

REQUIRED TOOLS & MATERIAL	QUANTITY
09729-97202 or Equivalent	1
Toyota Genuine Adhesive 1324, Three Bond 1324, or Equivalent	1

Repair Procedure

1. Drive the vehicle to confirm noise.
2. Replace both the left and right rear shock assemblies:
Refer to the Technical Information System (TIS), applicable model and model year Repair Manual:
 - 2016 Prius:
Suspension – Rear Suspension – “Rear Suspension: Rear Shock Absorber: [Removal / Installation](#)”
3. Confirm repair.