



# Service Bulletin

File in Section: -


Bulletin No.: 16-NA-144

Date: May, 2016

## TECHNICAL

**Subject:** Windshield Wipers Inoperative

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2010	2016			All	All
GMC	Terrain	2010	2016			All	All

<b>Involved Region or Country</b>	North America Only
<b>Condition</b>	Some customers may comment that the windshield wipers are inoperative.
<b>Cause</b>	 <p style="text-align: right;">4508271</p> <p>This may be caused by the wiper transmission linkage separating due to corrosion at the ball socket joints.</p>

**Correction**

If you encounter a vehicle with the above concern, complete the following steps:

1. Remove the air inlet screen. Refer to *Air Inlet Screen Replacement* in SI.



4508274

2. Once the screen is removed, visually inspect the wiper transmission and wiper motor link sockets for corrosion or damage.
3. If the sockets show signs of corrosion or damage, replace the wiper transmission and wiper motor. Refer to *Windshield Wiper Transmission Replacement* and *Windshield Wiper Motor Replacement* in SI.

**Warranty Information**

Labor Operation	Description	Labor Time
2080678*	Windshield Wiper Transmission and Motor Replacement	0.5 hr
*This is a unique Labor Operation for Bulletin use only.		

**Parts Information**

Description	Part Number	Qty
TRANSMISSION ASM-WSW	25948436	1
MOTOR ASM-WSW	25942547	1

Version	1
Modified	

