



# Service Bulletin

File in Section: -

Bulletin No.: 16-NA-157

Date: May, 2016

## TECHNICAL

**Subject:** Rear Door Handles Do Not Retract into Bezel

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Colorado	2015	2016				
GMC	Canyon						

<b>Involved Region or Country</b>	North America
<b>Condition</b>	Some customers may comment that the rear door handles do not retract fully into the bezel after door is opened or closed. May be necessary to push them into the full rest position.
<b>Cause</b>	This may be caused by the door handle bracket interfering with the lock cylinder.

### Correction

If the rear door handles have been found to be sticking in the bezel, the door handle brackets must be replaced with new brackets.

### Service Procedure

Refer to *Rear Side Door Outside Handle Bracket Replacement* in SI.

### Parts Information

Description	Part Number	Qty
RH Door Handle Bracket	13511031	1
LH Door Handle Bracket	13511032	1

### Warranty Information

Labor Operation	Description	Labor Time
2061420	Rear Side Door Outside Handle Bracket Replacement	Use Published Labor Operation Time

<b>Version</b>	1
<b>Modified</b>	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY  
TECHNICIAN  
CERTIFICATION