

Service Bulletin

File in Section:

Bulletin No.: 16-NA-266

Date: October, 2016

TECHNICAL

Subject: Remote Start Inoperative, Malfunction Indicator Lamp Illuminated with Possible DTC P0132 and/or P223E

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Envision	2016	2017				
Cadillac	ATS						
	CT6					LTG	
	CTS					LIG	
Chevrolet	Camaro						
	Malibu						

Involved Region or Country	North America and all N.A. Export Regions		
Additional RPO	BTV		
	Some customers may comment on the following conditions:		
Condition	Malfunction Indicator Lamp Illuminated.		
Condition	Remote start will not start the vehicle.		
	The Technician may find DTC P0132 and/or P223E set.		
Cause	This may be caused by a voltage spike in the ECM, above the threshold value which will set the code P0132 or P223E.		

Correction

If the DTC is set in two consecutive cycles, it will turn the MIL on. The MIL will reset after no fault 3 ignition cycles. DTC in history will clear after 40 ignition cycles. This set code will not impact the vehicle performance. If the conditions have been validated, the ECM must be updated.

Service Information

Update the ECM to the latest software and calibration available. Refer to *Engine Control Module Reprogramming with SPS* in SI.

Warranty Information

Labor Operation	Description	Labor Time
2810075	Engine Control Module Reprogramming with SPS	Use Published Labor Operation Time

Version	2
Modified	Oct. 12, 2016 - Included additional Models.

