



# Service Bulletin

File in Section: -

Bulletin No.: 16-NA-336

Date: October, 2016

## TECHNICAL

**Subject: Rear Park Brake May Not Release and/or Service Park Brake Message**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Envision	2016	2017			All	All

<b>Involved Region or Country</b>	North America and China
<b>Condition</b>	Some customers may comment that the rear park brake may not release and/or DIC Message "Service Park Brake" and/or a Warning Indicator illuminated.
<b>Cause</b>	This may be due to a rear brake caliper internally leaking brake fluid past the seal and onto the rear park brake actuator.

### Correction

If you encounter a vehicle with the above concern, replace the affected rear brake caliper and park brake actuator.

Refer to *Rear Parking Brake Actuator Replacement* and *Rear Brake Caliper Replacement* in SI.

### Parts Information

For part numbers and usage, see Brakes in Group 04.665 and 04.591 of the appropriate Parts Catalog.

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2480278*	Rear Brake Caliper and Park Brake Actuator Replacement	1.0 hr
*This is a unique Labor Operation for Bulletin use only.		

<b>Version</b>	1
<b>Modified</b>	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY  
TECHNICIAN  
CERTIFICATION