

Service Bulletin

File in Section:

Bulletin No.: 16-NA-353

Date: October, 2016

TECHNICAL

Subject: Accessory Remote Start Inoperative

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
Branu.	wiodei.	from	to	from	to		
Chevrolet	Malibu	2017	2017	SOP	HF129092		

Involved Region or Country	North America, Israel		
Additional RPO	S6P		
Condition	Some technicians may comment that the accessory remote start will not start the vehicle.		
Cause	This condition may be caused by missing software that controls the remote start.		

Correction

If the vehicles mentioned above were built prior to the VIN breakpoint, the BCM needs to be reprogrammed with the latest calibrations.

Service Procedure

Important: Verify the battery voltage is more than 12.6 volts but less than 15.5 volts before proceeding with reprogramming. The battery must be fully charged BEFORE reprogramming.

Before reprogramming the BCM, you must contact the Techline Customer Support Center (TCSC).

Update the BCM to the latest software and calibration available. Refer to *Body Control Module Reprogramming with SPS* in SI.

Important: During reprogramming, the battery voltage must be maintained within the proper range of 12.6-15.5 volts. CONNECT the approved Midtronics® PSC 550 Battery Maintainer (SPS Programming Support Tool (EL-49642) to the vehicle or the GR8 (EL50313) in the power supply mode.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810215	Body Control Module Reprogramming with SPS	Use Published Labor Operation Time

Version	1
Modified	