

## Backrest flap mechanism on 2nd seat row nonfunctional or sluggish

Topic number	LI91.12-P-063995
Version	1
Design group	91.12 Rear seats
Date	05-02-2016
Validity	166 SOP -Through VIN 4JG1668641A764238 with code 843 - Easy Entry rear seat
Reason for change	
Reason for block	

### Complaint:

Function impairment on 2nd seat row when backrest flap mechanism and Easy-Entry function operated

### Cause:

1. Loose or incorrectly attached Bowden cables
2. Sluggishness through inhibition of flap mechanism by locking lever on seat cushion frame of 2nd seat row

### Remedy:

1. Check Bowden cable of 60%- and 40% seat on 2nd seat row is correctly mounted, if necessary hook into place and check for correct routing.
2. Removal of lock lever with spring and pin onto seat cushion frame for 60% and 40% rear seat (pic.1; pic.2). Important: Locking lever can only be removed from inside.

Attachments	
File	Description
pic1.jpg	Locking lever from outside on 60% rear seat cushion
pic2.jpg	Locking lever from inside on 60% rear seat cushion

Symptoms
Body / Seat / Seat adjustment / Stiff/sluggish
Body / Seat / Seat adjustment / Function error
Body / Seat / Seat adjustment / Does not unlock

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			92N09 D6	Cable for right backrest release in rear seats
			92A09 D6	Cable for left backrest release in rear seats

# XENTRY TIPS

## WIS-References

Document number	Title	Note	Allocation
AR91.12-P-0001GP	Remove/install latch for locking rear seat		Remedy

## Attachments

pic1.jpg:



# XENTRY TIPS

---

pic2.jpg:

