

Noise from dashboard area

Topic number	LI42.10-P-064090
Version	1
Design group	42.10 Service brake
Date	05-17-2016
Validity	Model 205 (OM651)
Reason for change	Text
Reason for block	

Complaint:

Noise from engine compartment area reverberates through the dashboard into the interior of the passenger compartment.

Cause:

Possible constriction between expansion tank mounting (major assemblies compartment partition) and brake vacuum line.

Remedy:

Fit spacer grommet (A 001 997 06 44) to brake vacuum line, if necessary, replace vacuum line.

Attachments	
File	Description
Einbaulage__.pdf	Installation position

Symptoms
Chassis/suspension / Brake system / Service brake / Vacuum system / General

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 001 997 06 44			Spacer grommet	1		X
A 205 430 08 29			vacuum line	1	if necessary	X

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			43033 36	
43-2001	REPLACE GROMMET FOR VACUUM HOSE			

XENTRY TIPS

Validity		
Vehicle	Engine	Transmission
C (205) - 205.002	651.921	*
C (205) - 205.003	651.921	*
C (205) - 205.004	651.921	*
C (205) - 205.005	651.921	*
C (205) - 205.006	651.921	*
C (205) - 205.007	651.921	*
C (205) - 205.008	651.921	*
C (205) - 205.009	651.921	*
C (205) - 205.012	651.921	*
C (205) - 205.204	651.921	*
C (205) - 205.205	651.921	*
C (205) - 205.207	651.921	*
C (205) - 205.208	651.921	*
C (205) - 205.209	651.921	*
C (205) - 205.212	651.921	*
C (205) - 205.304	651.921	*
C (205) - 205.305	651.921	*
C (205) - 205.308	651.921	*
C (205) - 205.309	651.921	*
C (205) - 205.404	651.921	*
C (205) - 205.405	651.921	*
C (205) - 205.408	651.921	*