
Failure of stereo multifunction camera

Topic number	LI54.00-P-064149
Version	1
Design group	54.00 General
Date	05-23-2016
Validity	Valid for vehicles of BR205, BR253, BR217 and BR222 equipped with a stereo multifunction camera.
Reason for change	New software available.
Reason for block	

Complaint:

The following messages may appear on the instrument cluster when driving:

- "Active Lane Keeping Assist Inoperative" (code 238)
- "Adaptive Highbeam Assist Inoperative" (code 608)
- "Adaptive Highbeam Assist Plus Inoperative" (code 628)
- "Traffic Sign Assist Inoperative" (code 513)
- "PRE-SAFE Inoperative. See Owner's Manual" (code 23P)
- "DTR+:Steer Assist Inoperative" (code 266)

The systems stated here are no longer available.

The multifunction camera (stereo) control unit (A40/13) has DTC P180504 stored in it.

Cause:

Software release of multifunction camera (stereo) control unit (A40/13).

Remedy:

Optimized software for the multifunction camera (stereo) (A40/13) is included on Xentry DVD 05/2016 or newer.

Symptoms
Communication/information / Information display / Displays / Multifunction display / Multifunction display, error messages / Pre-Safe Inoperative
Communication/information / Warning and control system / Lane Assistant / Warning message in instrument cluster
Communication/information / Warning and control system / Speed Limit Assist / Warning message in instrument cluster
Overall vehicle / Lighting / Exterior lights / Driving lights / Adaptive Highbeam Assist / Warning message in instrument cluster

Control unit/fault code
