

Service Campaign Bulletin



Mercedes-Benz

Campaign No. 2016050001, May 2016

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model 207 (Cabriolet), Model Year 2016**
Check Right A-Pillar Seam Seal, Rework if Necessary

This Service Campaign has been initiated because Daimler AG (DAG), the manufacturer of Mercedes-Benz vehicles, has determined that the right A-pillar seam seal does not correspond to current series production specifications. As a result, sealant might not have been spread properly on the PVC seam which may lead to moisture ingress in the A-pillar under certain conditions. An authorized Mercedes-Benz dealer will check the seam seal at the right A-pillar on the affected vehicles and rework if necessary.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 415 vehicles are affected.

Order No. P-SC-2016050001

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin


Service Campaign Bulletin

Procedure

1. Move hood into upright position.



Figure 1

2.  Check seam seal in area of right A-pillar at (Figure 1) for defects:

 **Note:**

Clean area to be checked prior to inspecting.

- If seam seal is **OK** (continuous): Procedure is complete.
- If seam seal is **NOT OK** (not continuous): Rework seam seal in area of A-pillar at right.

 **Note:**

Allow seam seal to dry as per manufacturer specifications.

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
1*	Transparent seam sealant	A004 989 29 20	25%

* 1 container is sufficient for 5 vehicles. Submit as Qty. of 0.2 on the warranty claim.

i Note:

- Please be aware that only the part number(s) referenced in the Campaign Bulletin is/are approved for use to repair the vehicle. Repairs performed using any other part(s) will not have been performed in accordance with the campaign. Accordingly, warranty claims submitted with reference to an improper part number(s) will be denied.
- The following allowable labor operation should be used when submitting a warranty claim for this repair:

Warranty Information

Repair 1

Operation: Check seam seal at A-pillar at right (02-9437).

Damage Code	Operation Number	Labor Time (hrs.)
97 900 44 8	02-9437	0.1

Repair 2

Operation: Check seam seal at A-pillar at right (02-9437).
Rework seam seal at A-pillar at right (02-9438)

Damage Code	Operation Number	Labor Time (hrs.)
97 900 44 7	02-9437	0.1
	02-9438	0.1

i Note

Operation Number labor times are subject to change.

Workshop Equipment



Locally Sourced

Note:

Use a standard size caulking gun to apply the seam sealer p/n A 004 989 29 20 which is a 310ml caulking tube with the standard size plastic applicator tip.