

XENTRY TIPS

Sloshing noises from area of rocker panels/ longitudinal members

Topic number	LI63.30-P-058687
Version	2
Design group	63.30 Outer longitudinal members
Date	04-29-2016
Validity	Model series 207
Reason for change	Validity changed
Reason for block	

Complaint:

Sloshing noises from area of rocker panels/ longitudinal members on left and right.

Cause:

Due to clogged drain grommets at the bottom, water can collect inside the rocker panel.

Remedy:

- Remove longitudinal member panel.
- Remove grommets.
- Drain water.
- Dry rocker panel/ longitudinal member (e.g. in paint drying booth).
- Then preserve rocker panel/ longitudinal member with cavity wax.
- Fit new stop plugs (do not clean old stop plugs).
- Assemble vehicle.

Symptoms

Body / Body/Cab / Body sealing / Water entry

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 003 997 55 86			Grommets	0	See EPC for quantity	X
A 009 997 29 81			Grommets	0	See EPC for quantity	X

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
			63P01 **	Please state "Water in rocker panel" in message box.

XENTRY TIPS

			63B01 **	Please state "Water in rocker panel" in message box.
--	--	--	----------	--