

Rough 3-2 shift while decelerating

Topic number	LI27.00-P-063826
Version	2
Design group	27.00 General
Date	06-02-2016
Validity	GLE450 Coupe (292) with transmission 725.0
Reason for change	Updated Remedy
Reason for block	

Complaint:

3-2 downshift is occasionally rough when braking

Cause:

Engine software

Remedy:

Update ME and VGS using XENTRY DVD05/16 AddOn 5815, DVD03/16 AddOn 5814, or later.

After updating please perform a standstill adaptation of all upshifts and downshifts.

If the complaint persists after updating and adaptation, please create a PTSS case with an initial quicktest and EE-PROM txt file.

Symptoms

Power transmission / Automatic transmission / Function / Shifting is rough

Power transmission / Automatic transmission / Function / Poor shift quality

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
54-0650	12V		27017 45	
54-1011	QUICK TEST			
54-0991	SOFTWARE			