

smart audio system - Tone changes and fluctuations in volume

Topic number	LI82.60-P-062499
Version	2
Design group	82.60 Radio, audio/video systems
Date	04-08-2016
Validity	BR 453 smart audio system, SA code 505/562/537/561
Reason for change	- Remedy available
Reason for block	

Complaint:

In FM mode the tone or volume changes.

Cause:

- Internal parameter setting

Remedy:

Perform SCN coding of the Audio radio (A2) if software A453 902 9502 or newer is installed.

Perform programming and SCN coding if the software A453 902 9502 is not yet installed.

Note: After updating the software of the Audio radio (A2) with Xentry Diagnostics, always perform an update of the USB software!

This USB software can be found in the Xentry Portal; please also refer to LI82.60-P-063836.

Symptoms
Communication/information / Entertainment / Audio/Sound / Tone setting malfunction
Communication/information / Entertainment / Audio/Sound / Volume adjustment function error
Communication/information / Entertainment / Audio/Sound / Poor audio quality
Communication/information / Entertainment / Audio/Sound / Speed-dependent volume control (GAL) nonfunctional